IPMI Firmware Release Notes

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X10DRL-LN4
Release Version	3.87
Release Date	10/29/2019
Previous Version	3.80
Update Category	Recommended
Dependencies	None
	Update by this order: The early BMC FW below 3.73> 3.80> 3.85 and above, otherwise the BMC will lost FRU and all configurations*
Important Notes	 To update latest IPMI FW 3.85 or above. Please follow these procedure below: 1. If current IPMI FW below 3.73, please contact Tech Support to get IPMI FW 3.80 and update first, before update to 3.85 and above. 2. If current IPMI FW is between 3.73 to 3.84, it's "OK" to update IPMI FW 3.85 and above.
Enhancements	 Set Redfish scheme to be case insensitive. Blocked iKVM virtual storage if VM port is disabled.
New features	 Added display of all IPv4/IPv6 addresses on the sys_info page. Added IPv6 Static Router. Added support for KCM privileges. Set IPv6 to disabled by default. Added support for unique pre-programmed default password, form 299-00-190617-001.

	1. Fixed problem of upgrade to IPMI firmware 3.83 causing BMC to
	crash.
	2. Fixed problem of Web session timing out when logging into BMC
	with AD/BMC account.
	3. Fixed failure of IPMI to create a new event when attempting to log
	in using incorrect credentials.
	4. Fixed issue with display of long AD domain name.
	5. Fixed failure of SMSTC test with SUM 2.3.0.
	6. Fixed failure of SMSTC test with SMCIPMITool.
	7. Fixed issue of AOC_NIC_Temp sensor not displaying a value.
	8. Corrected NVMe Info through SMCIPMITool.
	9. Fixed failure to accept the special characters on the share host field.
Fixes	10. Corrected fan curve for VRM and DIMM under standard mode.
	11. Set license to activate when MAC changes and OOB source is
	enabled.
	12. Fixed mismatch of preservation in 3.85 and 3.86 firmware.
	13. Corrected behavior after updating BIOS through IPMI WebUI.
	14. Fixed problem of Web BMC alert email limiting the number of
	words.
	15. Followed Ultra system to adjust Health event log severity.
	16. Fixed failure of SUM IPMI test for Test Case 215.
	17. Added VM Security patch.
	18. Fixed failure of legacy power supply to respond to BMC.
	19. Fixed enable/disable for Launch KVM button.
	20. Fixed failure to mount CD-ROM image.