IPMI Firmware Release Notes

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X11SSW-F
Release Version	3.92
Release Date	12/24/2019
Previous Version	3.81
Update Category	Recommended
Dependencies	None
Important Notes	None
Enhancements	1. Blocked iKVM virtual storage if VM port is disabled.
New features	1. Added display of all IPv4/IPv6 addresses on the sys_info page.
	2. Added IPv6 Static Router.
	3. Added KCM privileges.
	4. Set IPv6 to disabled by default.
	5. Added support for unique pre-programmed default password, form
	299-00-190617-001.
Fixes	1. Added VM Security patch.
	2. Fixed failure of legacy power supply to respond to BMC.
	3. Fixed enable/disable for Launch KVM button.
	4. Fixed failure to mount CD-ROM image.
	5. Fixed problem of upgrade to IPMI firmware 3.83 sometimes
	causing BMC to crash.

6. Fixed Web session timing out when logging into BMC with AD/BMC
account.
7. Fixed failure of IPMI to create a new event when attempting to log
in using incorrect credentials.
8. Fixed issue with display of long AD domain name.
9. Fixed failure of SMSTC test with SUM 2.3.0.
10. Fixed failure of SMSTC test with SMCIPMITool.
11. Fixed issue of AOC_NIC_Temp sensor not displaying a value.
12. Corrected behavior after updating BIOS through IPMI WebUI.
13. Fixed problem of Web BMC alert email limiting the number of
words.
14. Followed Ultra system to adjust Health event log severity.
15. Fixed inability to launch JavaKVM through SMCIPMITool.
16. Fixed failure of SUM TC222 when running SUM TC212 and TC222
together.
17. Fixed loss of product key after updating BMC though Web/SUM.
18. Fixed problem of BMC continuously rebooting if the dedicated
LAN disconnects while dedicated mode is selected.
19. Fixed issues with CD-ROM image and support for special
characters in Config username.
20. Fixed problem with IPMI Web Virtual Media function and issue
with using @ in the user/password of CD-ROM image ISO mount.
21. Set System troubleshooting to support download of Version.txt,
Health event log, Maintenance event log, FRU, and SMBIOS
information.
22. Fixed problem with CD-ROM image ISO mount with SUM.
23. Fixed failure of SUM test.