IPMI Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X12DPU-6
Release Version	01.00.03
Build Date	4/21/2021
Previous Version	01.00.01
Update Category	Recommended
Dependencies	None
Important Notes	None
Enhancements	N/A
New features	N/A
Fixes	1. Fixed failure to add IPv6 link local address, problem of turning off "Web port" automatically turning off other ports at the same time, failure of IP Address to allow IPv6 format on "IP Access Control" page, problem of Unlock/Select button being enabled for Virtual CDROM/SMTP Password/RADIUS/DDNS (system lockdown mode), failure of Redfish SimpleUpdate API for BIOS firmware update, missing Storage page on IPMI, NVMe blink behavior after hot swap and ejection/insertion, mismatch of System Board Power Consumption Graph X-axis "Time Stamp" with system current time,

one 0xDC event description, ability to configure DNS Server IP/DNS
Server2 IP on Network page (system lockdown mode), inability to
remove selected file on the "Floppy Disk" due to out of frame icon,
ability to configure Network (IPv4/SSL cert/SSDP/DDNS) and HEL
(Warning!) check box for RADIUS user (Operator Privilege), ability to
configure IPv4/DDNS/HEL (Warning!) check box for Local/RADIUS
user (User Privilege), problem of Note box and hit message
overlapping and appearing out of frame on SSDP page, and sorting
result of "Total duration" field (Task list).
2. Fixed problem of Component information section under
CarrierBoard IPMI Web System Component Overview page,
malfunction of HTTPS redirect if not on default HTTP/HTTPS ports,
problem of downloaded Excel file containing event logs when no
category is selected, problem of DIMM Temp showing as N/A during
ON/OFF testing, and failure of SUM 2.5.2 (210112) MountIsoImage.
3. Fixed abnormality of CPU Max Speed on IPMI CPU page, failure of
IPMI sensor reading of all AOCs on all riser slots to show, problem of
Network Page Health Status displaying as Critical with non-sensor
AIOM card, problem of MEL order flipping after modifying IP Access
Control, problems of duplicate MEL entries for enabling/disabling IP
Access Control appearing and extra rule adding an entry after
disabling, and missing TelemetryService value in
SupportedCollectionFunctions.