

## BMC Firmware Release Notes

*Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.*

<b>Product Name</b>	X10DRU-i+
<b>Release Version</b>	3.94
<b>Build Date</b>	10/01/2021
<b>Previous Version</b>	3.91
<b>Update Category</b>	Recommended
<b>Dependencies</b>	None
<b>Important Notes</b>	None
<b>Enhancements</b>	None
<b>New features</b>	None
<b>Fixes</b>	<ol style="list-style-type: none"><li>1. Corrected an issue where the refresh button will re-mount a previously unmounted floppy disk from Virtual Media.</li><li>2. Removed the ability of users to create and activate a null user and password.</li><li>3. Fixed an issue where data was still retained in resolve.conf even after the BMC has been reset to factory defaults.</li><li>4. Fixed incorrect sorting sensor reading issues in Server Health page in BMC Web UI.</li><li>5. Fixed an issue where the OEM security BIOS Firmware failed during verification.</li><li>6. Fixed an issue where the smcipmitool failed to work correctly via SMSTC.</li><li>7. Corrected an issue where the SUMECO test case 315 returned an incorrect completion code.</li><li>8. Corrected the local BMC Password to support not more than 19 characters.</li><li>9. Adjusted the timeout for BIOS FW update when network speed was too slow. Now, when Web session timeout is 0, timeout of uploading a BIOS file will be 30 minutes. When a Web session timeout is less than 5, timeout of uploading a BIOS will be 5 minutes.</li><li>10. Fixed an issue when user disabled the VM port, the console redirection/HTML5 's virtual storage tab was still enabled.</li><li>11. Fixed an issue when after being switched to other languages, the BMC Web UI displayed erratically.</li></ol>