

IPMI Firmware / BIOS Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X11DPT-L
Release Version	3.77.08
Release Date	8/4/2023
Previous Version	3.77.03
Update Category	Recommended
Dependencies	None
Important Notes	None
Enhancements	N/A
New features	N/A
Fixes	1.[159450] - BRLY-2023-009 XSS attack [159451] - BRLY-2023-012 XSS attack [159423] - BRLY-2023-009 XSS attack [159425] - BRLY-2023-012 XSS attack [159426] - BRLY-2023-009 XSS attack [159427] - BRLY-2023-012 XSS attack 2.[ENGINEERING] JAVA KVM does not work when login operator account 3.[ENGINEERING] fix - Check the content of the obfuscation key buffer after decoding 4.Feature - Implement key obfuscation

	<p>5.[#157967] X11 Saving Dynamic DNS hostname with 63 characters gives an odd, non-popup error mess</p> <p>6.[153704] Ipmitool Chassis Identify Keeps UID LED Light On</p> <p>7.[ENGINEERING] Remove PN entry on storage monitoring page</p> <p>8.[ENGINEERING] To support AOC-MTG-i4T</p> <p>9.[ENGINEERING] - Modify mainPage redirect issue</p> <p>10.[ENGINEERING] VRM protection sync with SW team</p> <p>11.[X11]Fix - [144315] STD -- 10465 -- 1.76.47 -- BMC FW filename does not match</p> <p>12.[ENGINEERING] - Fix - Get device ID command would NOT report production/debug sign flag at 0x6 0x1 cmd</p>
--	---

Release Notes from Previous Release(s)

3.77.03(12/05/2022)

- 1.[ENGINEERING] - Modify mainPage redirect issue
- 2.[ENGINEERING] VRM protection sync with SW team
- 3.[X11]Fix - [144315] STD -- 10465 -- 1.76.47 -- BMC FW filename does not match
- 4.[ENGINEERING] - Fix - Get device ID command would NOT report production/debug sign flag at 0x6 0x1 cmd

3.76.31(02/22/2021)

- 1.[ENGINEERING] - fail to get volume information via REDFISH volume API.
- 2.[ENGINEERING] - fail to get volume information (MRVL) via REDFISH volume API.
- 3.fix - [120660] SMT_X11IPMI_17625-- IPMI- Network Privilege changed to "No Access" when the user is deleted thru tool
- 4.[122063] WebGUI will show special character username's hex ASCII code after modify
- 5.[122071] SMT_X11IPMI_17628-- Configuration mismatched
- 6.Support the Nvidia T4 GPU card; Support the Nvidia A10 and A40 GPU card
- 7.[ENGINEER] fix - Fix redfish patch response 302 status code
- 8.[ENGINEERING] Web Session does not timeout in system information page [119805] [Standard -- 8721 -- 3.76.24] Web Session does not timeout (X11SCW-F)
- 9.[121051] Select FW to upload doesn't work for the first time
- 10.[121050] Fix System still show normal when IPMI sensor failed
- 11.Kill web will cause web server close not completely
- 12.[120929] ECO -8700-- 3.99(9/4/2020) – Can add username with character less than 4
- 13.[120234] IPMI session time out during the bios update [120600] IPMI WEBGUI bios update will sometimes crash when updating [120575] fix - Flash bios from IPMI Web UI is failed.
- 14.[120567] IPv6 settings not sync between BIOS and IPMI
- 15.[116406] ECO-8700-3.98(09/04/2020)-Modify CT with Notebook(OA) though SMCIPMITOOL display undefined on webGUI
- 16.[116404] ECO-8700-3.98(09/04/2020)-undefined alert when open IKVM/HTML5 after close the port
- 17.[ENGINEERING] feature - Support SNMPv3 new OIDs and improve SNMPv1 trap
- 18.[119654/119759] Redfish automation failed on 3 test case regarding active directory
- 19.[ENGINEERING] - failed to read PECI through raw 0x30 0xE6

20.[116439] fix - SUM test fail.
 21.[119177] Fix "Event Log" field at SEL GUI screen is overlapped with "Keyword Search" field on Health Event Log Page
 22.[116045] 30 6a SUM' and 'ipmitool' do not match on DCMS/OOB license on X11DGQ-P
 24.[116298] fix - When the AOC-S40G-i2Q card is inserted, all sensor readings will be displayed as N/A.
 25.[ENGINEERING] Support IPv6/FQDN for LDAP/Radius/AD/Alert/VirtualMedia/SMTP/syslog/NTP/DDNS server.
 26.fix [ENGINEERING] fix - get Disk.Bay redfish return 500 on RAID mode
 27.[ALL] enhancement - "Redfish Managers.Network Protocol" SSDP catalog
 29.fix [ENGINEERING] fix - some account service items
 30.fix [ENGINEERING] fix - NVMe and RAIDIntrate status always warning
 31.[ENGINEERING] fix - redfish can't get permission via AD user while enable ad via SSL setting
 32.Fix - SATC Redfish API test case for BIOS upload
 33.Feature - Support HTML5 VM
 34.[ENGINEERING] Default disable SSDP

3.76.20 (07/16/2020)

1 [ENGINEERING] Fix HTTP/HTTPs port number cannot be applied after restore IPMI
 2 [ENGINEERING] enhancement - block more invalid input for Configuration Web
 3 [ENGINEERING] Fix - Removed sensitive parameters on pages: mainmenu, specifically Remote Console Preview
 4 [ENGINEERING] enhancement - Visa Security Sensitive parameters improvme
 5 [ENGINEERING] fix - fixed VISA security issue for maintenance web pages
 6 [ENGINEERING] fix - alert and AD web page issue
 7 [ENGINEERING] fix - modify user if given invalid input fix - fix problems when deleting an active directory
 8 AOC NIC Temp sensor reading shows
 9 [ENGINEERING] feature - add csrf prevention feature
 10 [ENGINEERING] fix bios/bmc update fail through SMCIPMITOOL/SUM
 11 [ENGINEERING] fix - stunnel port response
 12 [ENGINEERING] fix - dcmi power reading 0
 13 [ENGINEERING] feature - Support inband update FW event by OEM cmd 0x30 0xc4
 14 [ENGINEERING] fix - SSL Certificate update page turns to white page or 500 internal server error.
 15 [ENGINEERING] fix - server certificate and private key got cleared when user trying to update new SSL certificate and private key.
 16 [#107878] fix - [IPMI:3.76.09]BMC web display UPI error message Incorrect
 17 [#113839], [IPMI:3.76.17]Use SUM tool update BMC firmware fail
 18 1) [ENGINEERING] Customer need to set IPv6 static router prefix length value to 0 so that they can use default gateway. 2) [ENGINEERING] Remove IPv6 static router prefix length cannot input 0 limitation.
 19 fix - PB #114212 [IPMI:3.76.18]Run IPMI Automation IPMI execution exception occurred
 20 fix - PB #114130 [IPMI:3.76.18]Run Redfish Automation Tool Get Managers IKVM URI And Check fail