

IPMI Firmware / BIOS Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	H13SVW-N/NT
Release Version	01.01.12
Release Date	12/18/2023
Build Date	12/18/2023
Previous Version	01.01.05
Update Category	N/A
Dependencies	Recommend
Important Notes	ECO #29220 BMC_H13AST2600-ROT-1401MS_20231218_01.01.12_STDsp.bin Please update IPMI with attached Flash Utility in package.
Enhancements	1. Change RAS crash dump reset type to warm boot 2. Support IPv6 enhancement spec. (Proposal for BIOS-BMC IPv6 inconsistency_V11.pptx) 3. Update AMD RAS crash dump to ADDC 1.8 4. Support AS-1115S-FWTRT and AS-1115S-FDWTRT
New features	N/A
Fixes	1. [166052] ECO -- 21603 -- 01.01.10(2023/11/08) -- Web function -- Radio buttons of Host interface aren't disabled when system lockdown mode is on 2. [165582] [Management Plug-in for Nagios Core V1.2.0_build_230911] Nagios doesn't have event in Supermicro Event Receiver after remove fan or power cord 3. [165307] STD -- SW-- 01.01.09--No mel generated when changing Prefix length from 128 to 32 4. [165005] [AS-1115SV-WTNRT][HDS-TUN-KCMYXRUG1T92] Slot0 NVMe Link Speed will show N/A after AC power on system in Storage Monitoring Physical View 5. [164559] ECO -- 21603 -- 01.01.08(2023/10/06) -- IP access control permits identical duplicate rules 6. [151917] [AMD RAS][CH6] No show OS error log when execute "GMI3/xGMI3 Error Injection" 7. Fix the Sensor list fails when the temperature sensor is greater than or equal to 32 8. [161021] ECO -- 21603 -- 01.01.02(20230811) -- [GUI] Help page does not list related info of SSDP & LLDP 9. [163529] ECO -- 21603 -- 01.01.07(09/22/2023) -- [MEL] -- No related MEL when disable TSIG Authentication 10. [164898] ECO -- 21603 -- 01.01.08(2023/10/06) -- Web Function -- "Verify SSL Certificate" and "Accept Self-signed Certificate" shouldn't be selected if setting File Server to "http://xxxxx" 11. [163952] [AS-2015SV-WTNRT]When AOC-STG-b2T is installed on slot 5,"Health status" is incorrect under BMC Web GUI 12. Fix the Current owner index is wrong after RA provision 13. MEL-0135 displays more than 3 times 14. fixes the BMC cannot obtain IP 15. [163528] ECO -- 21603 -- 01.01.07(09/22/2023) -- [SUM] -- IPv4 DNS setting comparison wasn't the same after executing "ChangeBmcCfg" command via SUM [163845] ECO -- 21603 -- 01.01.07(09/22/2023) -- [SUM] -- IPv4 DNS setting comparison wasn't the same after executing "ChangeBmcCfg" command via SUM 16. [163529] ECO -- 21603 -- 01.01.07(09/22/2023) -- [MEL] -- No related MEL when disable TSIG Authentication 17. [162844] STD -- 21603 -- 01.01.05 (2023/09/08) -- WEB -- MEL is incorrect after do ikvm reset 18. [162823] ECO -- 21603 -- 01.01.05 -- Remote Console Preview current interface button enabled

	19. [160509] ECO — 21603 — 01.01.01(07/21/2023) — [MEL] — should non-set IPv4 DNS Server IP related MEL be shown when setup Hostname or not 20. [156498] ECO -- 21603 -- 01.00.18 -- [MEL] should non-set IPv4 DNS Server IP related MEL be shown when setup IPv6 DNS Server IP or not 21. [167011] [IPMI ECO 01.01.11] SATC Redfish Automation test failed; [166944] ECO -- 21603 -- 01.01.11 (2023/11/28) -- Redfish -- Checking SmartPower URL return code error
--	--