

IPMI Firmware / BIOS Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	H12SSG-ANP6
Release Version	00.01.15
Release Date	3/12/2024
Previous Version	00.01.06
Update Category	First Release
Dependencies	BIOS R 2.9
Important Notes	<p>IPMI Image: BMC_H12SSG-AST2600-ROT1PLUS-9301MS_20240312_00.01.15_STDsp.bin</p> <p>IPMI Update Package: BMC_H12SSG-AST2600-ROT1PLUS-9301MS_20240312_00.01.15_STDsp.ZIP</p>
Enhancements	<ol style="list-style-type: none">1. Added support for Nvidia L40,2. Added i2c protection map file for H12SSG3. Added support for "AMD V620 GPU", "AMD MI100 GPU"
New features	N/A
Fixes	<ol style="list-style-type: none">4. Added RTX5000-ADA and RTX6000-ADA GPU sensors5. Fixed invalid sensor name6. Fixed issue with POST request using invalid parameter with headers/files, status code should be 400 but it is 2027. Fixed incorrect MEL record when configuring Virtual Media.8. Fixed issue with BMC restarting message not matching with UI spec.9. Fixed Mount Floppy image failure via SUM10. Fixed failure to mount CD image via Redfish API11. Fixed issue where system can't launch one more ikvm session via Chrome/Firefox/Edge12. Fixed failure to Set LAN AutoConfiguration DHCPv6Mode Configuration

	<p>13. Fixed issue where MEL Log should be recorded when enable/disable LDAP/Active Directory/RADIUS</p> <p>14. Fixed issue where AD user name info should display when complete</p> <p>15. Fixed issue where troubleshooting table fields doesn't display complete</p> <p>16. Fixed issue where the DDNS BMC Hostname "tips" is not matching with text error check rule</p> <p>17. Fixed issue where help tips doesn't have SSDP</p> <p>18. Fixed issue where the Dedicated Link speed has 10M speed</p> <p>19. Fixed issue of No related MEL when set DDNS BMC Hostname</p> <p>20. Fixed issue of No related MEL when en/disable LDAP and set Account Lockout Durationa/counter reset.</p> <p>21. Fixed issue where NVMe webgui requires more time for ejection</p> <p>22. Fixed Stack buffer write overflow at H12 logout.cgi</p> <p>23. Fixed Command injection Cause: BMC config could be revised to make command injection situation Solution</p> <p>24. Fixed unexpected SEL was triggered when restarting Windows OS</p> <p>25. Fixed SMCIPMITool -- Response value is incorrect when delete user via SMCIPMITool" Synced fixing from OEM branch</p> <p>26. Fixed Incorrect MEL after enable/disable Host Interface" Synced fixing from OEM branch</p> <p>27. Fixed Incorrect MEL after configuring and saving Alerts" Synced fixing from OEM branch</p> <p>28. Fixed "FRU0 does not sync to FRU1 OK" Synced fixing from OEM branch</p> <p>29. Fixed Fan Mode naming should be "Heavy I/O Speed"" Synced fixing from OEM branch</p> <p>30. Fixed Failure to log in with user accounts with <>\ special letters" Synced fixing from OEM branch</p>
--	---

	<p>31. Fixed Repeated MEL after visiting Virtual Media page" Synced fixing from OEM branch</p> <p>32. Fixed Issue: "Redfish automation test failed" One failed case is AD login failed</p> <p>33. Fixed Issue: GPU Part Number missing from WebGUI" -- Use HBA board part number instead of GPU chip part number. Synced fixing from OEM branch</p> <p>34. Fixed Issue: "After SEL become full, events disappear in web page" --Fixing, 4096 system event logs need longer netowrk transmission time. Synced fixing from OEM branch</p> <p>35. Fixed Issue: Missing power supply DMI (type 39) information intermittently and DCMI power reading abnormal</p> <p>36. Fixed Issue: Fix CPU's TDP show 0 for Zen3 CPU (e.g. AMD Ryzen Threadripper PRO 5965WX (Chagall (Zen 3)))</p> <p>37. Fixed Issue: Response of IPMI oem cmd to do OEMGetSetDNSServer is wrong</p> <p>38. Fixed Issue: "BIOS ATS tool test Local Mac Address failed" Support oem command 0x30 0x68 0xe1</p> <p>39. Fixed Issue: "webgui sensors are not in order " Sorting Sensor of same type</p> <p>40. Fixed Issue: "Fail to reject invalid password for creating account through redfish" "Fail to log in with user accounts which are the combination of <letters> through GUI "</p> <p>41. Fixed Issue: Close button is out of the Preference frame for IKVM/HTML5</p> <p>42. Fixed Issue: Clicking 'Mount' button in HTML5 iKVM with no file selected will prevent mounting</p> <p>43. Fixed Issue: Web Notification Alert issue</p> <p>44. Fixed Issue: "redfish 503 Service Not Available" Use wrong image to do FW update would cause Redfish hang</p>
--	---

Release Notes from Previous Release(s)

00.01.06 (3/16/2022)

1. Fix "U.2 sensor lost during cburn on and off test"
2. Fix "Can't launch ikvm via JAVA"
3. Fix "ROT would wrongly trigger BIOS recovery when AC ON"
4. Fix "LCMC information will disappear and fan function abnormal after reboot."

00.01.04 (12/17/2021)

Initial Release