

IPMI Firmware / BIOS Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	H13SVW-N/NT
Release Version	01.02.04
Release Date	04/08/2024
Build Date	04/08/2024
Previous Version	01.01.12
Update Category	N/A
Dependencies	Recommend
Important Notes	ECO #29779 BMC_H13AST2600-ROT-1401MS_20240408_01.02.04_STDsp.bin Please update IPMI with attached Flash Utility in package.
Enhancements	N/A
New features	N/A
Fixes	1. (CVE-2023-48795) SMC-2024010013 Terrapin Attack vulnerability SMC-2024010010 Command Injection attack SMC-2024010011 XSS attack 2.(CVE-2023-33413) SMC-2024010012 Command Injection attack 3. Fixes (CPLD): Trapped in an endless loop of backup CPLD Golden 4. fixes the BIOS stops at POST code A2 when using BMC 1.2.0 5. Fixes the SATC Error: Test URIs Reachable When DCMS Activated 6. [172398] STD -- 21603 -- 01.02.01(2024/03/01)-- Web -- Fail to upload Valid File For TSIG Authentication 7. [172389] STD -- 21603 -- 01.02.01(2024/03/01)-- Web -- AC Power on and FIFO event log are disabled on operator privilege 8. [172297] ECO -- 21603 -- 01.02.01(2024/03/01) -- Web -- RADIUS web elements are disabled without license 9. Per AMD thermal design requirement, change TcIt, limit value to 95 10. Fix the front panel over the heart LED fail 11. [173422] ECO -- 21603 -- 01.02.01(20240301) -- The MEL displayed when add user via WEB UI and SMCIPMITool does not match 12. [173253] ECO -- 21603 -- 01.02.03(2024/03/18) -- Virtual Media error message of Path to Image has typo 13. [171621] ECO — 21603 — 01.02.00(2024/01/30) — [GUI] — Virtual Media help page description is inconsistent with UI Spec define

Release Notes from Previous Release(s) – these will be appended at the bottom of the current release notes in italic and in smaller print

01.01.12 (12/28/2023)

1. [166052] ECO -- 21603 -- 01.01.10(2023/11/08) -- Web function -- Radio buttons of Host interface aren't disabled when system lockdown mode is on
2. [165582] [Management Plug-in for Nagios Core V1.2.0_build_230911] Nagios doesn't have event in Supermicro Event Receiver after remove fan or power cord
3. [165307] STD -- SW-- 01.01.09--No mel generated when changing Prefix length from 128 to 32
4. [165005] [AS-1115SV-WTNRT][HDS-TUN-KCMYXRUG1T92] Slot0 NVMe Link Speed will show N/A after AC power on system in Storage Monitoring Physical View
5. [164559] ECO -- 21603 -- 01.01.08(2023/10/06) -- IP access control permits identical duplicate rules
6. [151917] [AMD RAS][CH6] No show OS error log when execute "GMI3/xGMI3 Error Injection"
7. Fix the Sensor list fails when the temperature sensor is greater than or equal to 32
8. [161021] ECO -- 21603 -- 01.01.02(20230811) -- [GUI] Help page does not list related info of SSDP & LLDP
9. [163529] ECO -- 21603 -- 01.01.07(09/22/2023) -- [MEL] -- No related MEL when disable TSIG Authentication
10. [164898] ECO -- 21603 -- 01.01.08(2023/10/06) -- Web Function -- "Verify SSL Certificate" and "Accept Self-signed Certificate" shouldn't be selected if setting File Server to "http://xxxxx"
11. [163952] [AS-2015SV-WTNRT]When AOC-STG-b2T is installed on slot 5, "Health status" is incorrect under BMC Web GUI
12. Fix the Current owner index is wrong after RA provision
13. MEL-0135 displays more than 3 times
14. fixes the BMC cannot obtain IP
15. [163528] ECO -- 21603 -- 01.01.07(09/22/2023) -- [SUM] -- IPv4 DNS setting comparison wasn't the same after executing "ChangeBmcCfg" command via SUM
16. [163845] ECO -- 21603 -- 01.01.07(09/22/2023) -- [SUM] -- IPv4 DNS setting comparison wasn't the same after executing "ChangeBmcCfg" command via SUM
17. [163529] ECO -- 21603 -- 01.01.07(09/22/2023) -- [MEL] -- No related MEL when disable TSIG Authentication
18. [162844] STD -- 21603 -- 01.01.05 (2023/09/08) -- WEB -- MEL is incorrect after do ikvm reset
19. [162823] ECO -- 21603 -- 01.01.05 -- Remote Console Preview current interface button enabled
20. Change RAS crash dump reset type to warm boot
21. Support IPv6 enhancement spec. (Proposal for BIOS-BMC IPv6 inconsistency_V11.pptx)
22. Update AMD RAS crash dump to ADDC 1.8
23. Support AS-1115S-FWTRT and AS-1115S-FDWTRT