

IPMI Firmware / BIOS Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	H13SVW-N/NT
Release Version	1.2
Release Date	08/01/2024
Build Date	08/01/2024
Previous Version	1.1b
Update Category	Recommended
Dependencies	N/A
Important Notes	ECO #30388 BIOS Image: BIOS_H13SVW-1D22_20240801_1.2_STDsp.bin BIOS Update Package: BIOS_H13SVW-1D22_20240801_1.2_STDsp.zip Please update BIOS with attached Flash Utility in package.
Enhancements	1. Update Agesa to 1.0.0.C 2. Update code base to 5.30_SienaCrb_0ACSF013.
New features	N/A
Fixes	1. Fixex the SUM test fail on the H13SVW-N/NT 2. Fixes the SUM GetBiosInfo mismatch with the actual BIOS binary file name (STDsd -> STDsp) 3. Fixes the SUM tool Fail to set secure boot key. (TC 3111/ TC4129) 4. Fixes The SUM tool specified next boot options feature doesn't restore the previous selection on the second boot.(TC1042) 5. Fixes the No password check during boot-up when set password check to 'Always'. 6. Fixes PBID#176651, the Dmesg have ACPI BIOS Error 7. Fixes PBID#176775 SUM test fail on the H13SVW

Release Notes from Previous Release(s)

Revision 1.1b(2023/12/20)

1. ATS issue: test case "Check PCI SSVID" fails.
2. [ID#164737] - BIOS will reboot uninterruptedly after updating BMC firmware version 01.01.09.
3. [ID#164732] - [IPMI ECO 01.01.09] The system always reboots at POST A2.
4. Fixed Test case "Check AC Power Loss Policy - Stay Off" fail.
5. [ID#165269] SATC Redfish Automation test failed.
6. [ID#164737] fixes TC2020 Automation test item Failure.
7. Fine-tune OEM FW ID table in JSON file; OEM FW ID JSON file only includes Siena microcode (for SUM or SAA)
8. Fine-tune cable plan with limited HW jump overwrite.

Revision 1.1a (2023/10/27)

1. Hidden Local APIC Mode due to PM's decision.
2. Disable PMIC error message reporting.
3. ID164978 - Some Micron DIMM 'MEM-DR516L-CL01-ER48' has different serial numbers between outside level and 'dmidecode' output.
4. ID163952 - [AS-2015SV-WTNRT] When AOC-STG-b2T install on slot 5 , "Health status" incorrect under BMC Web GUI.

Revision 1.1 (2023/08/25)

1. Fixes Redfish automation test failed items.
2. [AS-1115S-FWTRT] AOC-631102AC-ADAT port 2 cannot be detected under BIOS.
3. ID161750 - [AS-1015SV-WTNRT_EVT_H1_417](config4) Occur PST_BMC_SNSR_TOTAL sensor drop when execute DC onoff cycles.(Patch AOC-S25GC-i2S/i4S sensor lost issue.)
4. ID162504 - Fixes memory Detection error when the system plugs 2 DIMMs or 4 DIMMs in BIOS.

Revision 1.0 (2023/08/25)

First release.