

BMC Firmware Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X13DET-B
Release Version	1.03.33
Build Date	11/02/2024
Previous Version	1.02.14
Update Category	Recommended
Dependencies	None
Important Notes	<ul style="list-style-type: none">• SMC-2024010010 Command Injection attack.• SMC-2024010011 XSS attack.• (CVE-2023-33413) SMC-2024010012 Command Injection attack.• The BMC configuration file generated in BMC firmware older than Rev. 1.02.xx can't be imported.
Enhancements	<ol style="list-style-type: none">1. [ENGINEERING] — Replaced Model of redfish/v1/Managers/1.2. [ENGINEERING] — Added LDAP RFC2307bis support.3. [ENGINEERING] — Redfish should allow external account service password length more than 20.4. [ENGINEERING] — Added RSA2048 key for license server from new IT HSM.
New features	<ol style="list-style-type: none">1. [ENGINEERING] — Supported Redfish standard API /redfish/v1/LicenseService.2. [ENGINEERING] — Updated SEL Spec 1.39.3. [ENGINEERING] — Updated MEL Spec 1.08.4. [ENGINEERING] X14 — Moved Host Crash Dump to OemDumpService.Collect.

	<p>5. H100NVL and H200NVL GPU high CT and high NR definition are incorrect.</p> <p>6. [ENGINEERING] — Added BMCEvidence and BIOSEvidence dump of OemDumpService.Collect.</p> <p>7. [ENGINEERING] — Added SmartNIC related schema.</p> <p>8. [ENGINEERING] — Redfish Upgrade 2021.2, RF1.14.</p> <p>9. [ENGINEERING] — Supported new feature each field v1.33.</p> <p>10. [ENGINEERING] — Upgraded SEL to 1.38 and merged SEL search method to one function.</p> <p>11. [ENGINEERING] — Upgraded MEL to 1.07 and added MEL 70 and 368.</p> <p>Recorded wrong MEL number when uploaded IPMI config unsuccessfully.</p> <p>12. [ENGINEERING] — Redfish support BMC each field v1.33/ v1.34.</p> <p>13. [Engineering] — Added Qualcomm GPU Model, AI100.</p> <p>14. [ENGINEERING] — Supported NIC CPLD update.</p>
Fixes	<p>1. VMD "Auto" mode unable to get license key information from CPU (CPUOnDemand).</p> <p>2. [ENGINEERING] — Web UI Prompts – 11162023.</p> <p>3. [ENGINEERING] — Supported AOC-E810-XXVDA4.</p> <p>4. DNS Server 1 and 2 IP ability to be set to duplicate values via SMCIPMITool.</p> <p>5. Web Function — 0.0.0.0 is not allowed to be saved in 'Server Address'.</p> <p>6. It allowed class D, E of IPv4 addresses for DNS Server IP setting.</p> <p>7. Server Address field can fill in over 255 characters which does not match with the Spec definition. (AD and LDAP)</p>

	<p>8. Please help confirm whether the LAN interface on WebUI complies with the definition of SPEC (X12X13_BMC_UI_Network_Page_v0.2.pdf).</p> <p>9. [SUM] Could not mount ISO with IPv6 through SAMBA UNC. [SUM] Failed to mount an ISO file with IPv6 address (ExitCode:148).</p> <p>10. [ENGINEERING] — Supported AOC-S400G-B1C.</p> <p>11. Fails updating AIOM FW, AOC-A25G-i2SM via web GUI.</p> <p>12. Storage monitoring "Physical View" page didn't show NVMe FW information.</p> <p>13. Updating the Backplane, Midplane, Fan/CPU/AIOM/AOM board CPLD all should now present MEL ID with the MEL.</p> <p>14. [ENGINEERING] Correct CPU VCCON threshold.</p> <p>15. NIC_CPLD update failed with latest BMC FW.</p> <p>16. SPSversion in Redfish BIOS FW inventory URI does not show correct version.</p> <p>17. SYS-120TP-DTTR No log event shown in the maintenance event log when activating OOB license key with SUM in-band. SSG-610P-ACR12N4H Pilot Run — No log event shown in the maintenance event log when activating OOB/DCMS license key with SUM in-band.</p> <p>18. IPv4/IPv6 help page description is inconsistent with UI Spec definition.</p> <p>19. [ENGINEERING] — Missing LAN an Active Interface when setting Static IPv6.</p> <p>20. [AOC][X13SEDW-F/1.01A][SSG-521E-E1CR24H][Redfish] Cannot upgrade NIC AOC-S25G-B2s (Rev1.02) FW via Redfish API. [AOC][X13SEDW-F] System cannot be updated Firmware of NIC card by IPMI with AOC-S25G-B2S.</p> <p>21. [AOC][X13SEDW-F] Health Status greyed out and no Link Status icon on IPMI WEB UI with AOC-S25G-B2S.</p>
--	--

22. [ENGINEERING] — OSS Requirements.

23. [ENGINEERING] — Removed Action of ResetToDefault parameter "PreserveNetwork."

24. Sensors threshold '\LowNR\', '\Low CT\', and '\High NR\' show empty for Temperature Type.

25. (CVE-2024-36435) SMC-2023110008 Buffer Overflow vulnerability.
 [Security] GetValue does not control length limit and caused stack buffer write overflow at X12DPG-OA6.

26. [ENGINEERING] — Made PreserveNetwork backward compatible as Redfish 2020.

27. [Security] The vulnerability of XSS attack on KVM help page at X14SBM.
 [Security] The XSS attack on local storage value at X12STW.

28. Automation test fail due to incorrect MCU format.

29. DDNS accepting invalid characters.

30. [ENGINEERING] — Fixed LAN setting will change when rebooting BMC.

31. Redfish @odata.etag properties does not include surrounding "" double quotes.

32. [ENGINEERING] — Updated Fan list sort rule.

33. SEL Errors before System boots into Windows 2025.

34. [ENGINEERING] — The System button of Dashboard no reaction.

35. [ENGINEERING] — Updated slot format of Physical Storage view.

36. [ENGINEERING] — Adjusted license of OemDumpService.Collect.

37. [ENGINEERING] — Updated the SSDP Redfish version and fixed possible exception.

38. DDNS showing incorrect error message.

39. BMC Web disconnect issue after installed BlueField-3 B3220.

40. FAN icon does not change to Red Critical when FAN failed happened on BMC WebUI.

41. SAS drives are no longer listed under storage monitoring via Web GUI.

42. [ENGINEERING] — WEBUI HDD Temp and SSD Temp showed null and correct Drive Status.

43. [ENGINEERING] — Redfish 2021.2 failed to GET /redfish/v1/UpdateService/FirmwareInventory/Backplane_1_C_PLD_1.

44. At no license and OOB license, Health Event Log's Mark as Acknowledged button and Clear Acknowledgements button are disabled and do not show hover text message requiring DCMS license.
 With No/OOB License, Mark as Acknowledge button in HEL shall prompt up License Require diagram.

45. LDAP's StartTLS isn't in UI spec definition.

46. [ENGINEERING] — Removed PMEM SDR from X13 and B13 generation system monitoring.

47. Misspelled "necessary."

48. [ENGINEERING] — EventService RedfishEvent HTTPs allow self-signed CA.

49. Enhanced help page for Java iKVM to add OpenJdk information.

50. [ENGINEERING] — Prompt text update – iKVM over maximum sessions.

51. Updated BIND package to version 9.10.2-P2.

52. [RoT] MEL timestamp is incorrect when executing Update and Recover function under Platform Resiliency Actions page.

53. The "Disable KCS" option on the Web GUI is missing a space.

54. Operator privilege unable to modify AC Power On Event Log button and FIFO Event Log button in HEL page.

	<p>Error occurred when switching on/off "Enable AC Power On Event Log" and "Enable FIFO Event Log."</p> <p>Advanced Settings status cannot be changed Operator privilege Health Event Log successfully.</p> <p>Advanced Settings status cannot be changed successfully.</p> <p>55. [ENGINEERING] — Enabled FW update function for AOC-SLG4-2H8M2.</p> <p>56. [ENGINEERING] — Added MEL for Broadcom SAS FW update.</p> <p>57. Host Interface cannot be restored after reloading IPMI configuration.</p> <p>58. MEL for SNMP error.</p> <p>59. [ACL][2U MGX] AOC-LPE32002-M2 missing sensor and AOC info in BMC WebGUI. ACL: No Temperature Sensor for AOC-LPE32002-M2.</p> <p>60. [Security] — Case320078+ for Update is FAIL on 6202MS.</p> <p>61. Web_Func_Web session doesn't timeout after setting value. Web Session doesn't time out when reaching the set value.</p> <p>62. [Security] — Case320076+ for Active Directory is FAIL on 6202MS.</p> <p>63. WEB — There are no "System Diagnostics" help instructions in the help page.</p> <p>64. Help page should show Cooling instead of Fans and needed to add Air Cooling and Liquid Cooling descriptions. GUI — The introduction to Cooling isn't in the Help page; it still shows Fan.</p> <p>65. MEL is inconsistent with specs when changing states of memoryPFA and memoryHealthComp.</p> <p>66. Updated BIOS (Capsule) test fail. SUT is rebooted task status hang pending status on B14SBE-CPU-25G. Updated BIOS (Capsule) test fail. SUT is rebooted task rebooted task status hang pending status on X14DBG-GD.</p>
--	--

	<p>Checked Seamless Upgrade BIOS (Current BIOS) fail due to how MCU 2.3 cannot be updated.</p> <p>Capsule MCU Update via Redfish fail due to BMC status staying 'running' over 10 mins but progress still 0%.</p> <p>67. IPMITool — RAW gets channel authentication capabilities with invalid data length.</p> <p>IPMITool — Get device ID with invalid data length.</p> <p>IPMITool — Cold Reset with invalid data request.</p> <p>IPMITool — Get chassis capabilities with invalid data length.</p> <p>68. Sensor PCIe RT Temp failed and showed negative temperature.</p> <p>69. Temperature sensor displays as Drive Slot.</p> <p>70. Web — Hostname field behavior does not follow SW-PM definition when input over 63 characters.</p> <p>71. The SOL feature was retired in 2023 H2 at H12.</p> <p>72. Kept loading on the Task List page with Safari browser.</p> <p>Kept loading on the BMC Reset page with Safari browser.</p> <p>Kept loading on the BMC Settings page with Safari browser.</p> <p>Kept loading on the Account Services page with Safari browser.</p> <p>Kept loading on the page with Safari browser.</p> <p>73. [GUI] Error tips with IPv4 Address kept showing even input value is to be changed to valid by switching back to Auto Obtain IP.</p> <p>74. The network setting Redfish API got 500 error with unrestricted input at X12.</p> <p>DNS setting accepted unrestricted input and returned 500 error at B12DPT-6.</p> <p>75. TSIG Authentication can be enabled without key and private file</p> <p>76. Added static IPv6 address by RAW command (0x30 0x68 0x09), when more than six addresses, expected to get different return from BMC/SMCIPMI TOOL.</p>
--	--

	<p>Stateful IPv6 Mode in Auto Configuration does not match specifications.</p> <p>77. Updated invalid BIOS file on BMC web, error return is not user readable.</p> <p>78. [Auto][CombinedECO] Host Interface is OFF by default.</p> <p>79. Web Function — Only one Access Mode of SNMPv2 was set, yet an unrelated MEL log was still generated when deleting.</p> <p>80. Issue #182692 and #184540.</p> <p>81. BMC does not obtain an IPv6 Gateway IP when the IPv6 configuration is set to DHCPv6 Stateful on WEB.</p> <p>82. AOC-S3816L-L16IR does not support RAID5/6 but BMC GUI displays those options.</p> <p>83. Mel "[MEL-0097] IPv6 AutoConfiguration was disabled successfully." always followed after changing LAN interface.</p> <p>84. Web UI — Inputted invalid sender's address shows different error tips in SW vs. HW1.</p> <p>85. [ENGINEERING] — HTML5 and IKVM unstable in BMC 01.03.24 – 01.03.25.</p> <p>86. [ENGINEERING] [X13DEM] Thor2, some specific NCSI device need reinit NCSI when powered on.</p> <p>87. [DVT] ROT 2.0 After BIOS recovering action was triggered unable to generate the Evidence from WebGUI. [RoT] There is no Generate Evidence function when triggered BIOS and BMC recovered manually.</p> <p>88. [DVT] WebGUI updated CPLD test fail. Redfish Automation test 1 TC failed.</p> <p>89. Operator Permission on Virtual Media mount causes session time out.</p> <p>90. No IPv6 Address information in the Redfish multinode response when IPv6 IP is enabled.</p> <p>91. Redfish automation test failed 12 TCs.</p>
--	---

	<p>92. Added static IPv6 address by IPMI RAW 30 68 09, check in Dashboard somehow get unexpected IPv6 Address.</p> <p>93. IPMITool — RAW get/set/reset watchdog timer with invalid data length.</p> <p>94. [ENGINEERING] — M2_SSDx Temp reading is missing.</p> <p>95. [ENGINEERING] — Modified LicenseService support platform.</p> <p>96. Showed HTML tag when uploading configuration file.</p> <p> GUI — The prompt string in the upload BMC configuration has an extra space character.</p> <p> UI — Reloaded IPMI Configuration shows markdown in message "Upgrading new configuration...please wait until process is completed! BMC must be reset to apply any changes."</p> <p>97. [IPMI ECO 01.03.23] Updated MCU will hang when "Upgrade Progress:100%."</p> <p>98. Some SSD-only systems showed HDD Temp.</p>
--	--