## **BMC Firmware Release Notes Form**

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X13DEG-OA
Release Version	1.03.05
<b>Build Date</b>	11/7/2024
<b>Previous Version</b>	1.02.12
<b>Update Category</b>	Recommended
Dependencies	None
Important Notes	SMC-2024010010 Command Injection attack.
	• SMC-2024010011 XSS attack.
	• (CVE-2023-33413) SMC-2024010012 Command Injection attack.
	The BMC configuration file generated in BMC firmware older
	than Rev. 01.02.xx can't be imported.
	1. HTTP server support for Feature flags via Redfish.
	2. KCS Enhancement – Disable KCS via Redfish.
Enhancements	3. DMTF Compliance – Target URI of UpdateService.
	4. Non-OEM messages of task monitor of simple update with
	code 202 response payload.
	5. AOC/AIOM Enhancement.
New features	1. [Ticket #299-00-231215-001] JNLP and SOL retirement.
	2. Redfish API supports Broadcom Expander.
	3. On Board NVMe inject, eject.
	4. Certificate support for HTTPS BOOT in Redfish.

5.	Upgraded Redfish to 1.14.
1.	GPU L40S temperature reading is not same as Nvidia NVQUAL and cannot trigger fan speed.
2.	Failed to display Host IPv6 address after adding six addresses
3.	by IPMI RAW command (30 68 09 01).  [Security] CPLD Golden Update allows parameter partial match.
4.	MemoryMetrics at Redfish URI
	redfish/v1/Systems/1/Memory/num has OperatingSpeedMhz
	instead of OperatingSpeedMHz.
5.	Log entries from OEM sensors at Redfish URI
	redfish/v1/Systems/1/LogServices/Log1/Entries/num do not
	have a SensorType property even though OemSensorType is
	present.
Fixes 6.	[AS-1126HS-TN_EVT_H4B0][AOC-STGF-I2S] AOC-STGF-i2S
	should not show the link status under BMC UI. [178107] [AS-
	1126HS-TN_EVT_H4B0][AOC-AG-i2M]AOC-AG-i2M should not
	show the link status under BMC UI.
7.	IPMI Rom/FW update on AOC-S4116L-H16IR is successful but
	the task list shows failed with exception.
8.	Added some information to announce to users how to open
	the JNLP file.
9.	[Security] Out-of-bounds read/write at X13 and X12 IPMI
	(sdrs_checksum, Sensor_Init_Agent).
10	. GUI – IP Access Control Help page is inconsistent with UI spec.
11	. BMC RAID information cache problem.
12	. [IPMI 01.04.06 ECO] IPMI ECO automation test fail.
13	. [MEL-ID] for changing controller configuration.

14. [AS-1126HS-TN_DVT_H3] BMC Web UI cannot show the
current memory operating speed Copy Project Issue Link.