

BMC Firmware Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X13DEG-M
Release Version	1.01.23
Build Date	12/30/2024
Previous Version	1.01.18
Update Category	Recommended
Dependencies	None
Important Notes	<ul style="list-style-type: none">• SMC-2024010010 Command Injection attack.• SMC-2024010011 XSS attack.• (CVE-2023-33413) SMC-2024010012 Command Injection attack.• The BMC configuration file generated in BMC firmware older than Rev. 01.01.14 can't be imported.
Enhancements	<ol style="list-style-type: none">1. Supported PLX update via Webpage.
New features	<ol style="list-style-type: none">1. Supported liquid cooling page.

Fixes	<ol style="list-style-type: none"> 1. [EVT_Barebone_SYS-421GE-TNHR2-LCC] BMC Sensor Drop when executing DC on/off cycles. 2. [ECO_SYS-421GE-TNHR2-LCC_BMC_01.01.21] NCSI Function_Shared mode option disappeared. 3. [IPMI ECO][WebGUI] Test Case 4001 Login BMC Web with Operator privilege. Test fail. 4. [SCC_3.7.0_b2412061651_v2][SYS-421GE-TNHR2-LCC] SCC cannot receive [MEM-0001] event log when the SEL is triggered. [SCC_3.7.0_b2412061651_v2][SYS-421GE-TNHR2-LCC] System Event message on SCC website does not match BMC website. 5. [ECO_SYS-421GE-TNHR2-LCC_BMC_01.01.21] CPU overheat health event log occurred 2 times on the same time.
-------	--