

# BMC Firmware Release Notes Form

*Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.*

Product Name	X13DEM
Release Version	1.03.38
Build Date	12/03/2024
Previous Version	1.03.32
Update Category	Recommended
Dependencies	None
Important Notes	<ul style="list-style-type: none"><li>• SMC-2024010010 Command Injection attack.</li><li>• SMC-2024010011 XSS attack.</li><li>• (CVE-2023-33413) SMC-2024010012 Command Injection attack.</li><li>• The BMC configuration file generated in BMC firmware older than Rev. 1.02.xx can't be imported.</li></ul>
Enhancements	None
New features	None
Fixes	<ol style="list-style-type: none"><li>1. Redfish — MEL spec version mismatched on the Registries/Event API.</li><li>2. Case102011 for Login is FAIL on 7601MS. Case102011 for Login is FAIL on 2401MS.</li><li>3. Write FRU capability should be disabled after factory default.</li><li>4. [ENGINEERING] — DST offset for Lord Howe was 30 minutes.</li><li>5. IPMITool — Got channel payload support for valid/invalid channel fail.</li></ol>

	<p>IPMITool — Verified Reserve Device SDR Repository command via LANPlus but expect error.</p> <p>IPMITool — Verified device SDR info via IPMI LANPlus, expect error.</p> <p>6. Showed "N/A" for all missing VPD items.</p> <p>7. [ENGINEERING] — Open-Source update.</p> <p>8. GUI — Physical view/ Logical view elements does not exist.</p> <p>9. Web UI — IPMI Configuration prompt message does not match the specification.</p> <p>10. iKVM — Informative message for maximum open sessions does not align with the SPEC. BMC Informative message for more than four open sessions does not align with the SPEC.</p> <p>11. [ENGINEERING] — Fixed /redfish/v1/Chassis/1/Assembly return 404.</p> <p>12. [ENGINEERING][ALL] iKVM power cycle action won't generate MEL.</p> <p>13. AOC-X3522-P08G Temp Sensor and BMC Health Status not available.</p> <p>14. [ENGINEERING] — Modified LicenseService support platform.</p>
--	--