

IPMI Firmware / BIOS Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	H13SST-G/GC
Release Version	01.03.10
Release Date	02/18/2025
Previous Version	01.03.03
Update Category	Recommend
Dependencies	N/A
Important Notes	For AMD EPYC™ 9005 Series Processor support, please ensure your motherboard revision is R2.0 or higher. The BIOS and BMC package versions should be BIOS V3.0 or higher and BMC V01.03.03 or higher. Please note that if you would like to roll back the BIOS from V3.x (AMD EPYC™ 9004/9005 Series Processor) dual BIOS to V1.x (AMD EPYC™ 9004 Series Processor) single BIOS, make sure to install AMD EPYC™ 9004 Series Processor before updating the BIOS. To support AMD EPYC™ Bergamo/Genoa-X processor, please update to BIOS v1.4 or higher.
Enhancements	N/A
New features	1. AMD Turin MCTP bridging support
Fixes	1. Modify CPU threshold to 100 2. [186763] ECO -- 01.03.03 -- Web_Func -- Unable to save IPv6 DNS server IP 3. [177173] STD — 21603 — 01.02.06(2024/05/10) — [GUI] — Virtual Media help page has some descriptions are inconsistent with UI Spec defined 4. [176213] ECO -- 21603 -- 01.02.05(20240429) -- Launch Java Plug-in iKVM sessions and do iKVM reset, no iKVM closed [MEL-0132]

01.03.03 (09/26/2024)

1. Add Event log "[CPU-0021] CPU exceeds current motherboard's thermal design power (TDP)"
2. CPU cooling zone operates at full speed to prevent the CPU damage when the CPU temperature exception
3. [177441] [System (BIOS) Embedded Diagnostics] It doesn't support the System (BIOS) Embedded Diagnostics function on H13SSW
4. [ROT2-HW] Update(TEE): Release TEE version 0100.03.90
5. [181759] [IPMI 01.02.09 ECO] SATC automation test failed. [182076] Redfish SATC automation test failed. [184487] STD – 21603– 01.03.01 (2024/08/28) – Redfish – CurrentPeriod Error Counts changed after BMC reset. [184603] [BMC ECO 01.03.01 (08/28/2024)] SATC redfish automation test fail
6. Attestation Validation enhancement
7. [183407] ECO -- 21603 -- 01.03.00(20240726) -- 'Reset BIOS' page exist in BMC web, which is supposed to be new feature of 14 platform
8. [183429] ECO -- 21603 -- 01.03.00(20240726) -- Instruction of Virtual Media in iKVM Help page is not aligned between BMC teams
9. OpenSSH CVE-2024-6387 (regreSSHion)
10. [179169] PIO-2115GT-HNTR-NODE_MP_H1_223] IPMI WBE memory page no detect current memory speed
11. [178465] ECO-- 21603 -- 01.02.06 -- When IPv6 Address and Gateway IP are blank, saving Prefix Length as 64 or 1 reverts to blank after save

01.02.08 (06/18/2024)

1. Change TEE version as it causes CPLD update to fail
2. [178618] ECO-- 21603 -- 01.02.06 -- iKVM Reset message is: "iKVM service has experienced an unexpected issue, resulting in the closure of all active iKVM windows. To resume your activities, please relaunch iKVM windows."
3. [177943] (BIOS_H13SST-1C63-TS00290T00_20240530_1.6.V2_OEMsp, auto) When upload bios rom then abort will get error
4. [177173] STD — 21603 — 01.02.06(2024/05/10) — [GUI] — Virtual Media help page has some descriptions are inconsistent with UI Spec defined
5. [176224] ECO -- 21603 -- 01.02.05(20240429) -- Update BIOS on next boot, try to abort update process will result in unexpected failure
6. [176214] ECO -- 21603 -- 01.02.05(20240429) -- Update BIOS on next boot, Choose Requirements are not same as the original selection when try to abort update
7. [175324] ECO -- 21603 -- 01.02.04 (2024/04/08) -- WEB -- Should not "Disable" user success when user was in session
8. [174820] ECO -- 21603 -- 01.02.04(2024/04/08) -- Web Function -- The certification valid time period won't changed after uploading valid SSL Certificates and Private Key
9. [177103] ECO – 21603– 01.02.06 (2024/05/10) – Sensor – Missing space between the name of PSU fan

10. [175871] ECO -- 21603 -- 01.02.05 -- IPv6 Helpage has duplicate text "Please Note: Similarly,...the BMC should allocate a new IP address and discontinue the use of its previous IPv6 address
11. [171628] ECO — 21603 — 01.02.00(2024/01/30) — [GUI] — IPv4/IPv6 help page description is inconsistent with UI Spec define
12. [174573] ECO -- 21603 -- 01.02.01(20240301) -- IPv4 DNS Server IP behavior not match with error tips
13. [173425] ECO -- 21603 -- 01.02.01(20240301) -- error return when upload "TSIG .key" and "TSIG.private" with 0kb file on DDNS page is not specific
14. [175958] ECO -- 21603 -- 01.02.05(2024/04/29) -- SMCIPMITool(2.28.0_240411) -- NTP timezone unexpectedly changed after setting up primary address
15. [173149] [HDS-TMN-PJ1GW1920P] NVMe M.2 sensor display NA on BMC web GUI
16. Fix MB provisioning feature broken in tee 0100.03.79 and 0100.03.80.
17. [174348] [IPMIECO 01.02.04] SMTP help page description is inconsistent with SPEC, [171624] ECO — 21603 — 01.02.00(2024/01/30) — [GUI] — SMTP help page description is inconsistent with UI Spec define
18. [171628] ECO — 21603 — 01.02.00(2024/01/30) — [GUI] — IPv4/IPv6 help page description is inconsistent with UI Spec define
19. [173435] ECO -- 21603 -- 01.02.01(20240301) -- Fail to switch Remote Control interface from HTML5 to Java plug-in after do iKVM reset, [173434] ECO -- 21603 -- 01.02.01(20240301) -- Do iKVM(HTML5) reset, MEL will record extra [MEL-0131] iKVM was launched successfully
20. [171831] STD -- SW --01.02.00 -- After changing Network setting, Severity on MEL page becomes malfunction
21. [175071] ECO -- 21603 -- 01.02.04(20240408) -- Multi NodeB/C/D show "System Temperature" but NodeA dose not, [175072] ECO -- 21603 -- 01.02.04(20240408) -- Multi Node does not show "CPU Temperator" which is not match with Web UI SPEC
22. Per AMD thermal design requirement, change TcIt,limit value to 95
23. Fix front panel over heart led fail
24. [173422] ECO -- 21603 -- 01.02.01(20240301) -- The MEL displayed when add user via WEB UI and SMCIPMITool does not match
25. [173253] ECO -- 21603 -- 01.02.03(2024/03/18) -- Virtual Media error message of Path to Image has typo
26. [173051] [IPMI 01.02.01 ECO] IPMI no detect node information in "multi node" page, [172478] ECO -- 21603 -- 01.02.01(2024/03/01) -- Web -- Multi node page doesn't display node information
27. [171624] ECO — 21603 — 01.02.00(2024/01/30) — [GUI] — SMTP help page description is inconsistent with UI Spec define
28. [171621] ECO — 21603 — 01.02.00(2024/01/30) — [GUI] — Virtual Media help page description is inconsistent with UI Spec define
29. Fix SATC Error: Test URIs Reachable When DCMS Activated

30. [172478] ECO -- 21603 -- 01.02.01(2024/03/01) -- Web -- Multi node page doesn't display node information
31. [172398] STD -- 21603 -- 01.02.01(2024/03/01)-- Web -- Fail to upload Valid File For TSIG Authentication
32. [172389] STD -- 21603 -- 01.02.01(2024/03/01)-- Web -- AC Power on and FIFO event log are disabled on operator privilege
33. [171047] [BMCWEBUI] Automation tests Failure
34. Fix CVE-2023-4879 Terrapin Attack
35. (CVE-2023-48795) SMC-2024010013 Terrapin Attack vulnerability, SMC-2024010010 Command Injection attack, SMC-2024010011 XSS attack
36. (CVE-2023-33413) SMC-2024010012 Command Injection attack
37. Fix(CPLD): Trapped in an endless loop of backup CPLD Golden
38. [168628] [IPMI 01.01.13 ECO] There are no MEL when executing GMI error inject, [151917] [AMD RAS][CH6] No show OS error log when execute "GMI3/xGMI3 Error Injection"
39. Add SEL support for Post Package Repair (PPR) and MBIST
40. GrandTwin system supports system dual cooling zone
41. Support CPLD update
42. [166551] ECO -- 21603 -- 01.01.10(20231108) -- no BIOS & BMC option for Inventory Recover when no License key is activated

01.01.13 (12/26/2023)

1. C: Fix the non-A node does not change the MB CPLD register When the smart power is turned off
2. [167677] STD -- 21603 -- 01.01.11(2023/11/28) -- DNS Lookup toggle button isn't disabled when system lockdown mode is on
3. [166052] ECO -- 21603 -- 01.01.10(2023/11/08) -- Web function -- Radio buttons of Host interface aren't disabled when system lockdown mode is on
4. [165582] [Management Plug-in for Nagios Core V1.2.0_build_230911] Nagios doesn't have event in Supermicro Event Receiver after remove fan or power cord
5. [165307] STD -- SW-- 01.01.09--No mel generated when changing Prefix length from 128 to 32
6. [164559] ECO -- 21603 -- 01.01.08(2023/10/06) -- IP access control permits identical duplicate rules
7. [151917] [AMD RAS][CH6] No show OS error log when execute "GMI3/xGMI3 Error Injection"
8. Sensor list fails when temperature sensor is greater than or equal to 32
9. [161021] ECO -- 21603 -- 01.01.02(20230811) -- [GUI] Help page not list related info of SSDP & LLDP
10. [163529] ECO — 21603 — 01.01.07(09/22/2023) — [MEL] — No related MEL when disable TSIG Authentication

11. [164898] ECO -- 21603 -- 01.01.08(2023/10/06) -- Web Function -- "Verify SSL Certificate" and "Accept Self-signed Certificate" shouldn't be selected if setting File Server to "http://xxxxx"
12. Support AMD SB-RMI version 2.1
13. Enable 16-bit POST code
14. Support Smart_Power_Spec_v1.12
15. Change RAS crash dump reset type to warm boot

01.01.08 (10/06/2023)

1. Update AMD RAS crash dump to ADDC 1.8
2. PSU FAN page synchronization with PSU page
3. Support IPv6 enhancement spec
4. Fix Current owner index is wrong after RA provision
5. MEL-0135 displays more than 3 times
6. BMC cannot obtain IP
7. [163528] ECO — 21603 — 01.01.07(09/22/2023) — [SUM] — IPv4 DNS setting comparison wasn't the same after executing "ChangeBmcCfg" command via SUM/
[163845] ECO — 21603 — 01.01.07(09/22/2023) — [SUM] — IPv4 DNS setting comparison wasn't the same after executing "ChangeBmcCfg" command via SUM
8. [163529] ECO — 21603 — 01.01.07(09/22/2023) — [MEL] — No related MEL when disable TSIG Authentication
9. [162844] STD -- 21603 -- 01.01.05 (2023/09/08) -- WEB -- MEL is incorrect after do ikvm reset
10. [162823] ECO -- 21603 -- 01.01.05 -- Remote Console Preview current interface button enabled
11. [160509] ECO — 21603 — 01.01.01(07/21/2023) — [MEL] — should non-set IPv4 DNS Server IP related MEL be shown when setup Hostname or not
12. [156498] ECO -- 21603 -- 01.00.18 -- [MEL] should non-set IPv4 DNS Server IP related MEL be shown when setup IPv6 DNS Server IP or not
13. [162843] [IPMI 1.01.05 ECO] IPMI display "PCIE PERR error" when inject memory UECC/
[162842] [IPMI 1.01.05 ECO] IPMI display incorrect location when inject memory CECC/
[151917] [AMD RAS][CH6] No show OS error log when execute "GMI3/xGMI3 Error Injection"
14. Fix OTP flush error and should stop provision
15. [159725] [RoT] Update CPLD Golden image event log timestamp is incorrect
16. [160511] ECO -- 21603 -- 01.01.01(07/21/2023) -- Could not mount ISO via SMCIPMITool when Virtual Media does not mount any ISO or floppy

01.01.03 (08/23/2023)

1. Redfish support new OEM FixedBootOrder API to replace BootOrder for change bios boot option
2. [299 Phase 1] Disable IPMI Lan Port Interface
3. [299 Phase 1] HTML5 Console as default
4. [299 Phase 1] Dual mode for network setting as default
5. [299][MultVM] Virtual media support 3 CD/FLOPPY image mounting

6. *[Enhancement] Modify Dedicated Link options: Add 1G Full and remove 10M Half/Full*
7. *Fix PCIe dump issue with AMD RAS crash dump*
8. *[160511] ECO -- 21603 -- 01.01.01(07/21/2023) -- Could not mount ISO via SMCIPMITool when Virtual Media does not mount any ISO or floppy*
9. *[160497] ECO -- 21603 -- 01.01.01(07/21/2023) -- [GUI] -- Deditcated Link speed has 10M speed*
10. *Provision failed*
11. *[155635] [Bergamo][SD5_5.17.0_b1062] Redfish credential bootstrapping test fail flash BIOS need key-in user and password on H13SST*
12. *[155625] [Bergamo][SSM_5.4.0_build.1214]No CPU Speed in SSM System Information on H13SST*
13. *[156576] ECO -- 21603 -- 01.00.18 -- [MEL] generated MEL not quite match when add SNMPv2 (based on MEL SPEC v1.03)*
14. *[157556] [IPMI ECO 01.00.19]Redfish automation failure. [159180] [IPMI ECO 1.00.20]Redfish automation tool check is fail. [159406] [BIOS 1.5][IPMI 01.00.20]Redfish automation Failed. [159513] Redfish automation test failed.*
15. *[156537] ECO -- 21603 -- 01.00.18 -- Fail to add valid Prefix length128 for IPv6 Static Route List*

01.00.17 (03/29/2023)

1. *Expand IPMI OEM 80 commands.*
2. *(1) Enhance Power Event Handler/ (2) Add PWROK_SENSE and RST_SENSE debounce*
3. *Remove "short-term solution to improve NVMe eject/insert glitches".*
4. *Tune I3C clock parameters, to be compatible with more DIMM models.*
5. *[154317] ECO -- 21603 -- 01.00.15(02/24/2023) -- Function-- Able to click blink or insert HDD button when system lockdown mode.*
6. *[152261] ECO -- 21603 -- 01.00.12 (01/17/2023) -- GUI -- Help tips doesn't has SSDP*
7. *[153452] [ECO] [BIOS_1.1_20230117_IPMI_01.00.14] BMC will delay 7 mins to report AC lost event after remove power cord.*
8. *Modify power consumption.*

01.00.14 (02/10/2023)

9. *Enable IPMB*
10. *MB primary cpld jtag port is locked*
11. *Short-term solution to improve NVMe eject/insert glitches.*
12. *Improve the problem of SMBUS reading and writing NIC card*
13. *Update I2C protection map*
14. *RAS features according to AMD_MCE(draft)_v0.3.xlsx*
15. *Read incorrect Power Status without AMD CPU in H13 Platfor*
16. *[152125] ECO --21603-- 01.00.12 -- [MEL] No related MEL log when setup SNMPv3 Auth Protocol/ Private Protocol*
17. *[ECO] [CPLD F5.07.28] BMC have not "Power Supply Installed" event on Health Event Log when AC onoff cycle test*
18. *[150432]ECO--21603--01.00.09(12/05/2022)-- It should be have "Task Message" when BIOS firmware verify and updated completed*

19. [150530]ECO--21603--01.00.09(12/05/2022)--"Task Message" it's empty when BMC/BIOS generate evidence completed
20. Failed in IPMIECO TC0002, TC0019, TC2015 and error message "Cannot establish SSL connection"
21. When DIMM is inserted into position G1~F1, the incorrect DIMM name is displayed
22. [150972] ECO --21603-- 01.00.09 -- Vlan ID=1 not match with definition (check supported each field is v1.30 by redfish get BmcInfo)
23. [141588]IPMI Web - help page link confirm/ [146214]IPMI Web - help page link confirm
24. [149099] [ECO] [H13SST-G rev 1.1] BMC have record "[PWR-0028] Smart power was configured to OFF" event log when stress memory/system idle
25. Update SDR due to SSTDG_REV.4.07_06032022
26. Update SPL 01.00.23 and TEE 0100.03.43

01.00.04 (10/28/2022)

1. First release