

## BMC Firmware Release Notes Form

*Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.*

<b>Product Name</b>	<b>X13DEG-D</b>
<b>Release Version</b>	<b>01.03.21</b>
<b>Build Date</b>	<b>03/13/2025</b>
<b>Previous Version</b>	<b>01.03.16</b>
<b>Update Category</b>	<b>Recommended</b>
<b>Dependencies</b>	<b>None</b>
<b>Important Notes</b>	<b>None</b>
<b>Enhancements</b>	<b>None</b>
<b>New features</b>	<b>None</b>
<b>Fixes</b>	<ol style="list-style-type: none"><li>1. [10U-SYS-A21GE-NBRT-01-LL014] — Could not update GPU FW via the WebGUI.</li><li>2. (ISS195946) Rear fan B named mismatch between cooling tab and SEL event log.</li><li>3. (Fan) PSU Fan didn't spin at full speed in full speed mode.</li><li>4. (ISS196039) PCH Temp High CT does not meet SPEC.</li><li>5. [PB 194522] [Web] Missing existing and new version of BIOS after uploading BIOS firmware on WebGUI.</li><li>6. (ISS196043) CPU Temp, PCH, PLX Fan Duty show “0”.</li><li>7. C: If the system provides HGX_Chassis_0, replace the original UBB1 query URL with HGX_Chassis_0.</li><li>8. (ISS195864) UID feature did not work properly.</li><li>9. C: Fixed BMC firmware update issue.</li></ol>

	<p>10. C: [Redfish][FastCGI][Workaround] Monitor Memory usage and restarted FastCGI if exceeding 40 MB.</p> <p>11. C: [Web] Added missing LANG_SOL_MSG.</p> <p>12. (NIC, IPMI): PLDM sensor drop.</p> <p>13. (PLX): PLX update issues.</p> <p>14. [ETF][CoreWeave] Checked GET/PATCH/POST/DELETE for /redfish/v1/UpdateService/FirmwareInventory/HGX_A100 and status should be 404.</p> <p>[Auto][Redfish] Check GET/PATCH/POST/DELETE for /redfish/v1/UpdateService/FirmwareInventory/HGX_A100 and status should be 404.</p> <p>15. (ISU196723) Missing low and high CT for NVMe_SSDA Temp and HGX T-Limit.</p> <p>16. (SDR): Removed Unnecessary SDRs for PS7 and PS8.</p> <p>17. (SDR): Renamed sensor name by spec.</p> <p>18. [Auto][Gold][Web_Function] The following message appears after clicking the power button with power down/power cycle/power reset: “[MEL-0207] The host FW user password has been remove.”</p> <p>19. C: 183310 IPMITool — Valid ciphers list and the response of LAN print, channel getciphers IPMI.</p>
--	---