

IPMI Firmware Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	H14DSH
Release Version	01.01.04.01
Build Date	05/16/2025
Previous Version	01.00.10.00
Update Category	Recommended
Dependencies	BIOS V1.5
Important Notes	BMC_H14AST2600-ROT-9501MS_20250516_01.01.04.01_STDsp.bin - IPMI Image BMC_H14AST2600-ROT-9501MS_20250516_01.01.04.01_STDsp.zip - IPMI image and flash utility package
Enhancements	BIOS and BMC times synchronize when NTP is disabled
New features	N/A
Fixes	<ol style="list-style-type: none">1. Fixed Link status not detecting with AOC-CX766003N-SQ .2. Fixed GPU3 fan control.3. Fixed CPLD update warning message not matching spec.4. Fixed web function – the option can now be selected after clicking blank space.5. Fixed "AC Cycle" option in Power Control not being selected when System Lockdown Mode toggle is on or off.6. Fixed "AC Input Current" and "AC Input Power" information on the BMC WebGUI PSU page when the system is powered off.7. Redfish- Failed to test PATCH for valid DHCPv6 operating modes.8. Incorrect MEL is shown after selecting different BMC reset options.9. Power status always shows red on the BMC WebGUI when the system is powered on.10. Generated [MEL-0440] during LAN interface mode switch.11. Fixed Redfish error message.12. Fixed BPN CPLD version format to match SPEC.13. Remove WS_Management

Release Notes from Previous Release(s)

01.00.10.00 (02/13/2025)

[Fixes]

1. *The Redfish version is inconsistent between the web and the release notes.*
2. *Cannot successfully boot into OS after clicking power cycle.*

01.00.07.00 (11/08/2024)

[Fixes]

1. *Resolved mismatches between the BMC event log in SCC and the BMC WebUI.*
2. *Fixed the BMC SPL failover function test failure.*
3. *Addressed an issue where downloading the IPMI configuration file fails but MEL incorrectly shows a success message.*
4. *Corrected the BMC UFFN format retrieved through the SAA tool.*
5. *Resolved an indefinite loop in firmware update mode when an incorrect BIOS file is used.*
6. *Updated the BMC user guide link in the Web UI help page to point to X14/H14 instead of X13/H13.*
7. *Corrected mismatched backplane ID numbers in the Storage Monitoring Overview to align with the connected controller in the Storage Monitoring Physical View.*

01.00.03.00 (09/23/2024)

[Fixes]

8. *The CPU cooling zone operates at full speed to prevent CPU damage in case of a temperature exception- CPU temperature showing up NA/0 degree.*
9. *The restored BIOS warning message does not match the specification as defined.*
10. *After NVMe is ejected via webUI , it cannot be inserted back again . No NVMe drive is selectable.*
11. *Fixed owner privilege to support CPLD force update from X13 to X14*

00.00.19.00 (07/11/2024)

First release.