

BMC FW Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X12DPG-QT6
Release Version	01.05.22
Release Date	06/02/2025
Build Date	04/02/2025
Previous Version	01.04.08
Update Category	Critical
Dependencies	None
Important Notes	None
Enhancements	None
New features	None
Fixes	1.Stage bios fwUP with preserve_setting option, should preserve bios setting.2.ADC voltage sensor names follow 2.Supermicro_BMC_Sensor_Naming_Guideline_2.8.xlsx For example, "12V" changes to "MB 12V".

Release Notes from Previous Release(s)

01.04.08(11/18/2025)

- 1.[173425] ECO -- 21603 -- 01.02.01(20240301) -- error return when upload "TSIG .key" and "TSIG.private" with 0kb file on DDNS page is not specific. [172481] ECO -- 16914 -- 01.03.13(20240202) -- User is able to upload "TSIG .key" and "TSIG.private" with 0kb file on DDNS page.
- 2.bmc fwUP between 01.04 and 01.03 introduces "Compromised" MEL message.

3. Fix CVE-2023-4879 Terrapin Attack.
4. (CVE-2023-48795) SMC-2024010013 Terrapin Attack vulnerability SMC-2024010010 Command Injection attack SMC-2024010011 XSS attack 5. (CVE-2023-33413) SMC-2024010012 Command Injection attack
6.1. Follow all properties, and structures in the wiki
(https://wiki.supermicro.com/index.php/NS_SWPM:SW_PM/RedfishAPIList/X12)
8. Auto daylight saving function

01.03.04(06/17/2024)

1. [155644] ECO -- 20899 -- 01.00.48 -- [MEL] MEL log Description not quite match SNMPv3 Auth Protocol/ Private Protocol
2. [154331] [16721 -- ECO -- IPMI 01.01.24] Successfully deleting IPv6 DNS will always create a "IPv6 DNS server 0:0:0:0:0:0:0:0 was deleted unsuccessfully" entry in the Maintenance Event Log
3. [155126] ECO -- 18379 -- 01.01.11 -- DDNS can send multiple requests simultaneously that cause switchers out of shape
4. [152359] STD -- 16914 -- 01.01.38 (2023/01/04) -- Radius packet not follow RFC2865
5. [153419] STD -- 17212 - 01.00.42 - [Security] Global buffer read overflow at X13 and X12 redfish (/redfish/v1/Chassis/NVMeSSD.0.Group.0.StorageBackplane/Drives/Disk.Bay.{num})
6. [155021] Network IPv6 saving DNS Server IP as blank reverts to previous value; Auto Configuration fails to switch on once switch off
7. [154317] ECO -- 21603 -- 01.00.15(02/24/2023) -- Function-- Able to click blink or insert HDD button when system lockdown mode. [153387] ECO -- 18380 -- 1.01.11 -- System Lockdown SystemLockdown Storage Monitoring Physical View Eject / Insert button is not disabled
8. [153407] ECO--20899--01.00.44(02/03/2023)--It's conflict checking rule on "Remote User" and "Remote Groups" while click on "Save" button in AD/LDAP.
9. [154392] U2_SSD temperature does not reflect the hottest sensor reading on IPMI
10. [152308] STD -- 16914 -- 01.01.38 (2023/01/04) -- Syslog packet not follow RFC3164 Copy Project Issue Link
11. [154316] ECO -- 21603 -- 01.00.15(02/24/2023) -- Function-- Syslog packet not follow RFC3164
12. [154318] ECO -- 21603 -- 01.00.15(02/24/2023) -- GUI -- No popout error message when typ the wrong string at SNMPv2 Name field.
13. [155731] Redfish Automation 1 failed
14. [155021] ECO -- 16914 -- 01.01.41 -- Network IPv6 saving DNS Server IP as blank reverts to previous value; Auto Configuration fails to switch on once switch off
15. Better compatibility with IPMI ECO TC0002, 2036, TC2063, TC2076.
16. Disable TLSv1.0 and TLSv1.1
17. [151066] STD -- 20122 -- 01.13.08 -- Sensor naming not match with sensor specification
18. [Enhancement] Modify Dedicated Link options: Add 1G Full and remove 10M Half/Full execept X12STD-F and X12STE-F. * X12STD-F Dedicated Link is fixed in Auto Negotiation. * X12STE-F Dedicated Link is fixed in 1G Full.
19. [158900] NVMe info should be the same after UpdateBMC Fail [160218] [AS-1115SV-WTNRT_EVT_H1] The NVMe info is incorrect
20. bios version info is parsed from OFID, but not \$FID

21.[157516] ECO -- 21603 -- 01.00.19 (2023/05/26) -- GUI -- HDD info lines is not aligned at Physical View

22.[157552] Downgrade from BIOS1.5 to BIOS1.1, BIOS shown correct, but IPMI web still show BIOS1.5

23.[157592] [IPMI ECO 1.01.43]Sensor naming not match with sensor specification

24.[156015] ECO -- 16914 -- 01.01.43 -- UI Dashboard BIOS Firmware Version shows as 1.4b when it should be 1.5

25.[156317] STD -- 18605 -- 01.01.13 (20230426) -- Component Info: Expanded PSU Table Text Inconsistency

26.[155317] ECO -- 16914 -- 01.01.39(02/28/2023) -- SUM tool couldn't get BIOS build date, but web and SMCIPMITool show normally

27.[156190] ECO -- 20899 -- 01.00.52 --Fail to add valid Prefix length128 for Static Route List

28.[156182] No MEL log after configure the Mouse Mode setting

29.[155123] [IPMI 01.00.07] Sensor reading not match with SPEC.(Supermicro_BMC_Sensor_Naming_Guideline_2.4_Draft_03062023.xlsx)

30.[155400] [Solidigm D5-P5430][BMC 01.00.17] IPMI WebGUI Storage Monitoring does not show drive information

31.[161863] ECO -- 16914 -- 01.01.44 -- SUM Test case fails: 0030 - Ping BMC IP from SUT with different LAN interface.

32.[164404] [IPMI ECO 01.03.07] UID LED should be blinking but keep solid on when use WebUI UID Control

33.Fix fanFAIL feature broken from 01.03.01 to 01.03.06.

34.[158276] Redfish Hostname special characters support

35.2022/Q1_Q2 Phase 1 (Ticket #299-00-220311-001) (<http://superform.supermicro.com/Home/WorkFlow/eForm/Preview?docId=c37217ed-e3d3-4915-a8b9-39c1b7b6098d>)

36.2021/Q1_Q2 (Ticket #299-00-210204-001) for IPv6 (<http://superform.supermicro.com/Home/WorkFlow/eForm/Preview?docId=527f1ee9-6f6e-4546-a475-e02f1b737b4b>)

37.[157552] Downgrade from BIOS1.3 to BIOS1.1, BIOS shown correct, but IPMI web still show BIOS1.3

38.Support IPv6 enhancement spec. (Proposal for BIOS-BMC IPv6 inconsistency_V11.pptx)

39.[157570] [IPMI 01.01.04] Redfish SATC automation test has failed.

40.[153153] New Feature --21992 -- 09.01.01 -- [Kendo] Health status of task list is not complete when zoom in from 75% to 200%

41.[153067] New Feature--18367--09.02.15(02/14/2023)--[Kendo]DDNS upload invalid key help tips is overlap when zooming to 200%.

42.[153097] New Feature --21992 -- 09.01.01 -- [Kendo] NTP server error message will exceed the fram and overlap with side bar when zoom in from 100%

43.OEM-Telus -- 19018 -- 11.03.32 (06/26/2023) -- WEB -- BMC version is incorrect in troubleshooting Log.

44.2021/Q1_Q2 (Ticket #299-00-210204-001) (<http://superform.supermicro.com/Home/WorkFlow/eForm/Preview?docId=527f1ee9-6f6e-4546-a475-e02f1b737b4b>)

45.[153113] New Feature --21992 -- 09.01.01 -- [Kendo] Upload invalid IPMI Configuration file help tips is overlap when zoom in to 200%

46.[153069] New Feature --21992 -- 09.01.01 -- [Kendo] Power consumption is not complete when zooming from 110%

47.Support both CDC-ECM and RNDIS at the same time.

48.[299 Phase 1] Disable IPMI Lan Port Interface

49.[299][MultVM] Virtual media support 3 CD/FLOPPY image mounting

50.[Enhancement][Account Services][LDAP] Support StartTLS.

51.[299 Phase 1] HTML5 Console as default

52.[299 Phase 1] Dual mode for network setting as default

53.[168343] [ECO] LDAP Support StartTLS fail

54.[169515] -- ECO -- 16914 -- 01.03.11(12/20/2023) -- [GUI] Maintenance Event Log and License Activation have the same number at Help Page

55.[167511] [ECO] Launch SOL prompt message overlap

01.01.33(11/03/2022)

1. Support Nvidia H100 GPU reading.
2. Avoid ME hang during bios-cloning-GOLDEN operation

01.01.24(07/01/2022)

- 1.Reminder: Please have EE to validate i2cmap feature during eco this validation process
- 2.During bmc fwUP, keep fan speed. During bmc reset, keep fan speed.
- 3.Add option in BMC UI to create disabled user or edit user to disable.
- 4.Storage feature broken in 01.01.10.
- 5.STD -- 17212 -- 01.01.04 -- [Security] Specific strings could brute force the BMC directory.
- 6.Support Preserve BIOS Boot Options Configuration when updating BIOS FW.
- 7.Ma3.Improve PSU initialization code, add delay and retries.x number of SEL up to 4096.
- 8.[137924] STD -- 16416 -- 01.01.22 (2022/02/15) -- Add SNMP type user Not have * to inform Auth Key and Private Key are required items
- 9.[138264] ECO -- 16774 -- 01.01.16 (2022/02/15) -- Language Change title string not translated
- 10.[137300] ECO--15340-- 01.01.13(01/27/2022) -- Create new user on web UI should not get error, even though the user ID is occupied on NoAcces user.
- 11.[138110] ECO--15340-- 01.01.16 (02/15/2022) -- It should not present "Delete" icon while login "Operator" or "User" privileges account. [138112] ECO--15340-- 01.01.16 (02/15/2022) -- Modify password while login "Operator" or "User" privileges account will return Oops error!
- 12.No GPU found on WEB BMC
- 13.[137093][Redfish API Automation test failed]
- 14.[137368] [ECO -- 10349 -- 01.01.13 (20220127) -- Mount failed pop up error message and Even log are incorrectly
- 15.[137442] ECO -- 15338 -- 01.01.13(20220127) -- Mount *.img display wrong file type on Java iKVM Virtual Media
- 16.[137357] ECO -- 17274 -- 01.01.13(01/27/2022) -- Update invalid FW will show MEL message when update BIOS and CPLD
- 17.[137186] [LCS-GPU MI210] GPU information is not correct on IPMI WEB GUI.
- 18.[136988] IPMI ECO] Unspecified Event Log Assertion When AC ON
- 19.[136663] ECO -- 17046 -- 08.10.19 (01/07/2022) -- iKVM(JAVA plug-in/HTML5) should be support IMA file type. [137280] ECO--15340-- 01.01.13(01/27/2022) -- iKVM(JAVA plug-in) should be support "IMA" image.
- 20.[137087] GPUs missing under GPU tab in IPMI Web GUI [137010] GPU and CPU liquid cooling pump SEL error in Liquid cooled system, and no GPUs detected
- 21.All Broadcom AOC controllers such as 3008, 3616, 38xx and 39xx will not been discovered.

22.[136607] IPMI ECO Update BIOS failed
 23.[135002] STD -- 17212 -- 09.14.10 BETA -- [Security] ipmitool can set lan mode out of range
 24.[134964] [BMC-Intel VROC 7.5 OOB] Please grey out "Create Raid" icon if no more physical drive available to create new Raid volume.
 25.[134545] STD-- 18379 -- 01.01.00-- Function -- Can't sync NTP server when BMC has IPv6 DNS
 26.[134183] STD -- 17212 -- 01.01.08 -- Password goes wrong when contains \
 27.[134282] STD -- 17212 -- 01.01.08 -- [Security] XSS attack at Notification Alert Redfish protocol
 28.[134398] ECO --16461 -- 01.00.25 (12/03/2021) -- Unable to mount "Floppy Disk" while upload the *.ima file.(Virtual Media)
 29.[132297] BMC mount/unmount ISO file test fail Copy Project Issue Link
 30.[139329][DVT SYS-F511E2-RT] Judgment mechanism for network AOC health status
 31.[139811] STD --18605 --X12DGO -- 01.01.04 -- Inconsistent behavior between BMC and BIOS manually Recover
 32.[135651] STD -- 17212 ?V 09.14.10 BETA ?V [Security] Maintenance event log display error at /cgi/op.cgi (config_smtp)
 33.[142830] Standard -- 16914 -- 1.1.23 -- Active Directory Remote Group character cap too short
 35.Improve bmc boot stability
 36.[140249] Power Average Usage reading value is higher then Max Peak value under Power Consumption
 37.[142091] ECO -- 16914 --01.01.17(2022/03/04) -- VROC RAID status still show ok When RAID is degrade.

01.00.21(10/22/2021)

1.During bmc fwUP, keep fan speed. During bmc reset, keep fan speed.
 2.Better compatibility with redfish ATT, after applying the security patches.
 3.TEE OS 0x42 error message on IPMI MEL doesn't match with "Kernel code segment (offset: ##) was compromised
 4.After MB cpld fwUP, if system is off, bmc will power_on the system.
 5.[130496] Can't open JAVA iKVM under Windows Server OS
 6.Refactor FD related codes
 7.[130248] STD -- 16914 -- 01.00.15 -- [iKVM] "Mouse Settings" tabs did not translated into other language on HTML5. d "Close" tab is not translated in Japanese.
 8.System with AST2600 have hang issue when running DC on/off testing with Red hat 8.3, We find the eSPI will hang after system hang, Aspeed provide us to clear 0x1e6ee080 bit 30 to 0.
 9.[132364] The System observed front panel LED lighted up RED when servers turned on
 10.Fix SUM inband feature broken
 11.[131690] "Save" button was not an proper placement for the "CLEAR ALL the Event Logs?"
 12.[130982] ECO -- 20033 -- 01.00.39 BETA (09/11/2021) -- NTP show fail message after setting
 13.[130248] STD -- 16914 -- 01.00.15 -- [iKVM] "Mouse Settings" tabs did not translated into other language on HTML5. d "Close" tab is not translated in Japanese.
 14.Shouldn't allow user to set user name and password to the same
 15.config can't save Sendre of SMTP
 16.webGUI "CPU Speed" info data source has been fixed from MaxSocketSupportedSpeed to OperatingSpeed

01.00.15(07/31/2021)

1. webGUI login should be ok after a session reset.
 2. [128071] Onboard LAN MAC and information mismatched between on "Network AOC - Component info" and "Dashboard"
 3. [127933] [AST2600 A3] system hang and lost BMC connection after update CPLD from WebGUI or SUM

4. [127840] Beta -- 16728 -- 01.00.07 -- RADIUS Server Address Input Issue Copy Project Issue Link
5. [New feature] Change location name in NIC page (AIOM->System Slot A#, PCIE-> System Slot #) Fetch location name from [Chassis/1/Thermal] When thermal name include [AIOM], the location field should show [System Slot A#]. When thermal name include [AOC], the location field should show [System Slot #]. When thermal name include [AOCUR_NIC the location field should show [System Slot 0].
6. bmc boot firmware flash uses 3byte mode
7. Improved bios update internal flow
8. Better compatibility with provisioning rot_checker script 2021Q2.
9. When a new image being programmed is introducing a new/older version of RollbackID to the one programmed in RoT, BMC will automatically update Golden Image in addition to Active Image because the Golden Image with smaller RollbackID to that in RoT is unusable for recovery.
10. [New feature] Change location name in NIC page (AIOM->System Slot A#, PCIE-> System Slot #) Fetch location name from [Chassis/1/Thermal] When thermal name include [AIOM], the location field should show [System Slot A#]. When thermal name include [AOC], the location field should show [System Slot #].
11. bios firmware upgrade, refactored the codes.
12. [128764] BETA--17212--10.86.04--[Security] Server will escape original double quotes in json format when receive an empty value.
13. [128572] T4 GPU temperature sensor show as NA on BMC (feature broken in bmc 01.00.11)
14. Evidence should not blocked fwUP in 2021-07 release.

01.00.06 (05/10/2021)

- 1.fixed the following PB issues: [124351] Componet information section is incorrect under CarrierBoard IPMI Web System Componet Overview page. [125472] Std ?V 16914 ?V 1.00.02 ?V https redirect will not perform properly if not on default http/https ports [125510] STD-- 00.10.92 -- Downloaded Excel file shouldn't contain any event log when no category is selected [125582] [IPMI] DIMM Temp show N/A during ONOFF testing [125654] [Re-open/FW:01.00.02] SUM 2.5.2 (210112) MountIsoImage Fail
- 2.fixed the following PB issues: [124097] CPU Max Speed is abnormal in IPMI CPU Page [124285] Fail to see IPMI sensor reading of all AOC on all riser slots [125315] [IPMIECO 00.10.97] Network Page Health Status will display Critical with non-sensor AIOM card [125468] Std -- 16914 -- 1.00.02 -- [webGUI] MEL order flipped after modifying IP Access Control [125469] Fix duplicate MEL entries for en/disable IP Access Control + extra rule added entry after disable [125470] Std -- 16914 -- 1.00.02 -- [REDFISH] TelemetryService missing value in SupportedCollectionFunctions
- 3.fixed the following PB issues: [123845] - After install M.2 PCIE card . 3VCC sensor signal is failed [124185] - IPMI ECO- IPMI automation failed due to 1.2V BMC is not in the lab criteria.
- 4.fixed the following PB issues: [121445] Garbage value displays in health event logs for Marvel RAID card. [121648][IPMIECO 00.10.81] IPMI Web - Virtual Media - Virtual CD-ROM can import invalid symbol for input option. [121722] Standard -- 16914 -- 00.10.80 -- Un-authorized process (sshd in /sbin/) accessing critical data (platform.conf) while modifying Port. [122021] OEM- 19233-05.10.16(01/05/2021) -- Modification button for ADMIN user should not be enabled in system lockdown [122046][IPMIECO 00.10.82] IPMI Web - Virtual Media - Virtual CD-ROM can import invalid symbol for input option. [122137] SYS-610U-TNR PVT Burn-in Issues [122344] Standard -- 16914 -- 00.10.84 -- Active Directory Binding missing domain [122534] BETA --18367 -- 09.12.01 BETA(01/12/2021) -- Save will return "ERROR:A general ..." when the SNMPv3 is "OFF".(SNMP) [122668] Standard -- 16914 -- 00.10.85 -- BMC hang on factory default at random occasion
- 5.fixed the following PB issues: [116379] X12DDW-A6 got a lot fail at X12 Redfish auto test [118614] AOC_NIC fan speed control is not following fan curve/ BMC cannot detect all AOC_NIC temp in system. [119740] SATC redfish automation failed. [120958] No VDimm sensor reading in IPMI Web [121280] [IPMI 00.23.21 ECO] Power fail events are not match with SPEC. [121884] [SYS-620U-TNR-FE01] The

prompt description when BMC reset is easy to confuse users. [122054] [SYS-620U-TNR-FE01] After update BIOS via WebUI, the system will be Power on but the prompt message is still "System is rebooting..." [122056] [SYS-620U-TNR-FE01] When update BIOS via WebUI, the prompt message "System is rebooting..." stays for too long. [122058] STD-16914- 00.10.83 - WebGUI should contain create RAID0 operation for Marvell NR2241-B [122068] [IPMIECO] IPMIECO automation always got dcmi power reading 0w error [122119] Fixed VD Rebuild issue in Redfish and RAID 0 VD creation issue in Redfish. [122124] [IPMI Firmware v10.83 ECO] Redfish automation test failed (1 Failure) [122134] [Storage Monitoring]Link Speed and Link Width issue [122322] Beta -- 16914 -- 00.10.83 -- Elements Are Not Disabled Correctly For Account Privileges

6.fixed the following PB issues: [121833] When AC on, IPMI sel log will appear SPI Channel attack is prevented sel log. [121949][AOC] AOC Card Thermal reading issue [121988] Please provide system for checking Expander Temp sensor reading [122046][IPMIECO 00.10.82] IPMI Web - Virtual Media - Virtual CD-ROM can import invalid symbol for input option. [122057] Incorrect CreateVDActionInfo attribute value in Redfish for Marvell NR2241-B. [122159] [IPMIECO 00.10.83] IPMI Web System - Component Info - Product Info item display order isn't match spec.

7.fixed the following PB issues: [119946] [RoT] No BIOS recoverd from golden image event log in SEL [121512] STD-16914- 00.10.79 - Configure parameter error for creating RAID on WebGUI Marvell NR2241-B [121518] Error message pop up when turn on NTP [121747] [IPMIECO 00.10.81] Definition conflicts in the two sensor documents.

8.fixed the following PB issues: [121199] Hardware Monitor Check Fail [X12SPL] [121315] Node 1 front panel UID LED stays solid on after updating PDB CPLD FW through IPMI Web GUI [121524] The SYS-120C-TN10R failed the FTU test. The sensors read the status at "nc". [121582] [IPMIECO 00.10.79] IPMI Web - System - Compoent Info - Overview - CPU health status error. [121648] [IPMIECO 00.10.81] IPMI Web - Virtual Media - Virtual CD-ROM can import invalid symbol for input option.

9.fixed the following PB issues: [119358] [RoT] Please confirm the download evidence file name. [120189] [Non-VMD mode]IPMI WEB eject and insert function can't work [120411] BETA --16914 -- 00.10.75(11/25/2020) -- The "NTP Enable/ Daylight Savings Time" button UI abnormal. [121020] No Virtual Raid information in Logical View page [121059] ECO -16914-- 00.10.76 (12/3/2020) -- Close/Enable system lockdown will be stuck at confirmation window sometimes [121082] SATC redfish automation cannot test [121170] [IPMI] SK Hynix PE8010 missing disk information from IPMI WebGUI [121294] SMT_X12AST2600_ROT_001077p -- Downloaded Excel file shouldn't contain any event log when no category is selected [121298] STD-18380 -- 01.00.21(12/18/2020) -- Button is enabled for operator user for SSDP and SSL Certificate [121301] SMT_X12AST2600_ROT_001077p -- Downloaded sensor file mismatch WebGUI [121403] [BMC event] Severify of "System NIC (0) IPv6 IP Change" should be Warning not OK and "PDSlotx not present - Deassertion" event incorrect" but assertion one is pass under the BMC WebUI_Health Event Log on the X12SPL. [121406] [BMC event] Severify of "System NIC (0) IPv6 IP Change" should be Warning not OK and "PDSlotx not present - Deassertion" event incorrect" but assertion one is pass under the BMC WebUI_Health Event Log on the X12SCZ-TLN4F [121509] Fixed mismatched RAID VD strip block size. [121510] Fixed reversed vendor/device/sub-vendor/sub-device IDs [121530]The DCPMM naming should be "PMEM" in IPMI sensor reading, not "DCPM"

10.fixed the following PB issues: [120685] Remote Console Preview monitor function failed with User privilege account

11.Refactor the NCT6683 discovery process

12.fixed the following PB issues: [119401] Alert subject will appear special character after sending mail automatically. [120835] GPU RTX8000 active temp threshold is not correct [121055] ECO -16914-- 00.10.76(12/03/2020) -- Incorrect Alert when open IKVM VM tab after close VM port [121056] ECO - 16914-- 00.10.76 (12/3/2020) -- Close VM port but NMAP [121059] ECO -16914-- 00.10.76 (12/3/2020) -- Close/Enable system lockdown will be stuck at confirmation window sometimes

13.fixed the following PB issues: [118805] No add-on card sensor reading when install the card on RSC-S2R-68G4 [120904] BETA --18367 -- 09.00.01(12/07/2020) --Sort symbol not present on "Platform Resiliency Actions" list after change language.

14.fixed the following PB issues: [110472] IPMI sensor reading auto refresh button [119596] JAVA iKVM virtual keyboard display not completely [120072] OEM-18605-- 00.10.10(11/11/2020) -- Save NTP server will show NTP disable sometimes [120411] BETA --16914 -- 00.10.75(11/25/2020) -- The "NTP Enable/ Daylight Savings Time" button UI abnormal. [120422] Many Voltage sensor type activities logged during system stress [120509] BETA --16914 -- 00.10.75(11/25/2020) -- Export excel content is not match selected languages. (Sensor Readings/Health Event Log/Maintenance Event Log) [120517] BETA --16914 -- 00.10.75(11/25/2020) -- When input "Hostname" have interval can't save successfully and without error message. [120555] BETA --16914 -- 00.10.75(11/25/2020) -- "Export to Excel" become to English when language changed. (Health Event Log/ [120558] IPMI ECO automation with 00.10.75 ipmi version,12v sensor voltage is not in %5 range [120578] BETA --16914 -- 00.10.75(11/25/2020) -- "Export to Excel" has two UI design. (Health Event Log/Maintenance Event Log) [120581] BETA --16914 -- 00.10.75(11/25/2020) -- Sensor Thresholds not translated to Chinese simplified /Japanese. [120590] [MB 2.00] MB_25G Temp sensor show N/A [120787] [BIOS ECO 1.0]10G LAN Temp [120872] [Beta Test]Check IPMI WEB sensor reading onboard 1G NIC Temp should not be detected

15.[125298] Error message pop up after modified web port

00.10.76 (12/03/2021)

1. First Release.