

BMC Firmware Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X13DDW-A
Release Version	1.03.19
Build Date	05/08/2025
Previous Version	1.03.05
Update Category	Recommended
Dependencies	None
Important Notes	<ul style="list-style-type: none">• SMC-2024010010 Command Injection attack.• SMC-2024010011 XSS attack.• (CVE-2023-33413) SMC-2024010012 Command Injection attack.• The BMC configuration file generated in BMC firmware older than Rev. 01.01.14 can't be imported.
Enhancements	None
New features	<ol style="list-style-type: none">1. [299-00-240516-001] Implementation of Power Control Buttons.
Fixes	<ol style="list-style-type: none">1. [SYS-621C-TN12R_MP_H1B10_Comp_3836] Unable to identify "Link Status" icon of GPU-NVDPU-BA3220-C under BMC WebUI.2. BMC Unit Reset breaks SNMP for Zabbix.

3. [IPMI ECO 01.03.11] The Chassis Intrusion sensor showed a critical error. [194350] WEB — The "Reset Intrusion" function was not working normally.
4. [Redfish] Members@odata.count attribute should not be 0. (SharedNetworkPort)
5. [Redfish] Response show 404 when getting URI '/redfish/v1/Chassis/1/Sensors/AOC_PORT3Temp.'
6. [Auto][Gold][Web_Function] Date and Time could not be set correctly via PATCH method.
7. JavaAP jarsigner with newly issued certificate.
8. Remote Control iKVM console: "The maximum number of open sessions has been reached! Please close this iKVM window" and Help page: "The maximum number of open sessions has been reached!" messages did not match exactly.
9. [ECO] Inlet Temp and M.2 threshold were incorrect.
10. WebGUI "Reset Instruction" button feature broken.
11. [Auto][Web_Function] The power icon status cannot be updated to current power status after powered on/off.
12. GUI — Remote Control help page was inconsistent with UI spec.
13. Web function — After reloading IPMI Configuration File, the SNMPv2 settings were not preserved.
14. [MEL] — The Maintenance Event Log description about updating AOC did not match spec.
15. Web UI — Dashboard — Check RemoteControl Preview text 'HTML 5' had an extra space.
16. [IPv6] Changed IPv6 mode rule for BIOS display dynamic IPv6 address issues.
17. The name of the item "Chassis Intru" did not match to SPEC.
18. The descriptions of [MEL-0184] did not match the spec/

	<p>19. [Security][External] OpenSSH security upgrade (CVE-2025-26466).</p> <p>20. [Auto][Web Function] Unit Reset button should be enabled during system lockdown.</p> <p>21. IPMI ECO] Redfish automation has two fails.</p> <p>22. Improvement with TC2028.</p>
--	---