

IPMI Firmware / BIOS Release Notes Form

Super Micro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Super Micro and the Super Micro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2017 Super Micro Computer, Inc. All rights reserved.

Product Name	X11DPU-X(LL)
Release Version	1.38
Release Date	11/10/2017
Previous Version	1.33
Update Category	Recommended
Dependencies	None
Important Notes	N/A
Enhancements	1. Improved the help message descriptions to follow Help Menu Suggestions v1.8. 2. Adjusted VBAT's low battery threshold from 2.7V to 2.6V for new battery-cell BR2032.
New Features	1. Added support for HII in Redfish.
Fixes	1. Fixed problem of help message not matching template. 2. Fixed failure of SUM GetBmcCfg. 3. Removed Upper Critical event log on CPU sensors to follow new thermal guide (SIM_TDG REV. 4.06). 4. Fixed inability of IPMI firmware 1.36 to flash BIOS with SUM. 5. Fixed inability to read AOC-3108-H8i temperature. 6. Fixed inability to detect 2x U.2 NVME SSD in IPMI WebGUI, problem

	<p>of fan speed control not working with firmware revision 01.35, problem of Standard Speed and Full Speed fan modes being the same for IPMI 1.35, and failure of fan PWM for SIS_TDG 4.06.</p>
--	---