

# IPMI Firmware / BIOS Release Notes Form

*Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.*

<b>Product Name</b>	<b>H11DSi / H11DSi-NT</b>
<b>Release Version</b>	<b>1.0c</b>
<b>Release Date</b>	<b>2/14/2018</b>
<b>Previous Version</b>	<b>1.0b</b>
<b>Update Category</b>	<b>Critical</b>
<b>Dependencies</b>	N/A
<b>Important Notes</b>	<b>ECO# 20378 BIOS Image H11DSI8.207 Please update BIOS using attached Flash Utility in .zip package</b>
<b>Enhancements</b>	<b>1. Updated AMD AGESA to 1.0.0.5 based on AMI CRB_014.</b>
<b>New features</b>	N/A
<b>Fixes</b>	<b>1. Fixed problem of only a single M.2 device being detachable from an AOC-SLG3-2M2 card when installed in slot #3. 2. Fixed inability to enter LSI3108 OPROM menu via keyboard connected to USB 2.0 ports.</b>

*Release Notes from Previous Release(s)* – these will be appended at the bottom of the current release notes in italic and in smaller print

### **1.0b (12/28/2017)**

1. *Updated AGESA code to NaplesPI 1.0.0.3.*
2. *Implemented Machine Check Error (-22) workaround.*
3. *Added PCIe slot bifurcation support for AOCs.*
4. *Fixed problem of system stopping at post code 0x91.*
5. *Fixed problem of USB keyboards not responding when connected via USB 2.0 hub(s).*
6. *Fixed Memory Interleaving (Disable) functionality.*
7. *Fixed problem of OS IP being altered after flashing BIOS.*
8. *Fixed problem of Intel X550/X710 NIC link width dropping.*

### **1.0a (10/31/2017)**

1. *Updated AGESA to NaplesPI\_1.0.0.1 Patch 1.*
2. *Updated xGMI signal tuning tables.*
3. *Implemented display of ECC DRAM Error Location in BIOS and recording of log number in BMC SEL.*
4. *Removed “System Firmware Error (POST ERROR)” logging to BMC.*
5. *Removed “EFI 01030006” BIOS Event Log.*
6. *Fixed problem of SATA HDD location on Boot Menu indication not matching silkscreen.*

### **1.0 (8/25/2017)**

*Initial Release*