

IPMI Firmware / BIOS Release Notes Form

Super Micro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Super Micro and the Super Micro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2017 Super Micro Computer, Inc. All rights reserved.

| | |
|-------------------------|--|
| Product Name | X11SRM-(V)F |
| Release Version | 1.0a |
| Release Date | 11/7/2017 |
| Previous Version | 1.0 |
| Update Category | Critical |
| Dependencies | None |
| Important Notes | N/A |
| Enhancements | 1. Updated ME to 11.11.50.1402. 2. Fixed inability of system time to set to build time when clearing CMOS. 3. Updated RSTe legacy/uEFI option ROM version 5.3.0.1052. 4. Added VGA priority selected by slot feature. 5. Modified GPP_H21 & GPP_D5 to GPO low. 6. Added item to control PERR/SERR report. |
| New features | None |
| Fixes | 1. Disabled all of the clock request by GPIO features from ME setting. 2. Fixed inability of AOC-3008L-L8E to enter setup normally. |

| | |
|--|---|
| | <p>3. Fixed problem of TPM 1.2 PS index not being Write-Protected so that the content of TPM 1.2 PS index still can be modified after TPM 1.2 is nvLocked.</p> <p>4. Fixed problem of the boot order having garbage when IPMI tool set is used to system boot into BIOS setup menu.</p> <p>5. Fixed problem of incorrect BANK LOCATOR of Type 17 appearing.</p> <p>6. Fixed failure of ChkSmbiosX64.efi check when using SK Hynix DIMM.</p> <p>7. Fixed inability of VGA priority to change to auto/onboard VGA when incorrect slot is selected.</p> |
|--|---|