

IPMI Firmware

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X10DSC+
Release Version	3.70
Release Date	3/21/2018
Previous Version	3.63
Update Category	Recommended
Dependencies	None
Important Notes	None
Enhancements	1. Upgraded NTP to version 4.2.8p10 to fix security issue. 2. Optimized Intel NVMe P4500 display on IPMI NVMe SSD webpage. 3. Hid unused power supply information on power source page.
New features	1. Added support for GetSetBMCStatus command for TAS. 2. Added auto-refresh to sensor reading page. 3. Added save button to WebUI Server Health->Sensor reading page. 4. Set system event log to record most configuring operations.
Fixes	1. Fixed problem of IPMI not returning to login page automatically after reloading IPMI Configuration. 2. Fixed problem of AC cycle stress testing making BMC crash because of uncorrectable SMBIOS file. 3. Fixed problem of SMCIPMITool and WebGUI showing different values for PSU FAN RPM. 4. Fixed issue with port configure page value check.

	<p>5. Fixed abnormal syslog display.</p> <p>6. Fixed missing NVMe Eject button on IPMI webpage.</p> <p>7. Set LDAP default IP address to show as 0.0.0.0.</p> <p>8. Fixed incorrect power history record after AC cycle stress test.</p> <p>9. Fixed problem of iKVM not working properly after iKVM reset.</p> <p>10. Fixed inability of No Access User Network Privilege to be displayed on User page.</p> <p>11. Fixed inability to erase hostname on network page.</p> <p>12. Fixed problem of power history record page timing out due to abnormal power peak.</p> <p>13. Enabled AOC MAC address to show on system page without TAS.</p> <p>14. Fixed problem of the power supply FRU being empty in DMI after the AC is first powered on.</p> <p>15. Fixed missing chassis intrusion status in IPMITool chassis status.</p> <p>16. Fixed inability of iKVM reset to close iKVM console.</p> <p>17. Fixed failure of SMCIPMITool "pminfo" command on firmware 3.68.</p> <p>18. Fixed typo errors on Factory Default page, on System Event Log page, in language file of "Power Consumption", on BIOS Update page, on SMC RAKP page, on Activate License page, in XPath /html/body/table/tbody/tr[5]/td[2]/ul/li[1]/span, and in language file of key "LANG_SERVER_HEALTH_ADV_CAPTION".</p> <p>19. Fixed problem of too many system event logs breaking BMC.</p>
--	---