IPMI Firmware / BIOS Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

X11DPT-B
2.1
7/13/2018
2.0b
Critical
None
None
1. Updated CPU microcode to address 'Spectre' derivatives (CVE-
2018-3639 & CVE-2018-3640) security issue.
2. Updated 5.12_PurleyCrb_0ACFD088 for Purley Skylake platform
PLR7, BKC 2018 WW20.
3. Updated Giga LAN EFI driver 8.3.0.4 (IBA 23.1).
4. Updated SPS 4.00.04.340 PV PLR7 version.
5. Updated SATA RAID OPROM/EFI driver to RSTe PreOS v5.4.0.1039.
6. Corrected default setting for Enable SmcBusMasterEn setup item.
7. Corrected BIOS/ME downgrade check for SPS 4.0.4.340.
8. Added support for UEFI mode PXE boot of F12 hot key Net boot.
9. Added one event log to record that the event log is full.
10. Updated BIOS ACM 1.3.7 and SINIT ACM 1.3.4.
N/A

	1. Fixed problem of SUM GetSataInfo showing incorrect
Fixes	"Configuration Type" when setting "Configure sSATA as" to "AHCI" or
	"RAID" on sSATA controller.
	2. Fixed problem of Ctrl + Alt + Del causing system to hang after
	flashing BIOS.
	3. Fixed missing NVDIMM ADR setup item.
	4. Fixed problem of system hanging when installing Linux OS after
	COM1 & COM2 IO/IRQ exchange.

Release Notes from Previous Release(s)

2.0b (2/24/2018)

1. Updated CPU microcode to address CVE-2017-5715 security patch issue.

2. Updated 5.12_PurleyCrb_0ACFD085Beta for Purley Skylake platform PLR 4, BKC WW02.

3. Added setup item "SmcBusMasterEn" for enabling Parent bridge of the devices in the gSmcPciForceEnableBusMasterList.

4. Changed RC default setting to upgrade POST Memory correctable error to uncorrectable error and map out the channel.

5. Added support for System Firmware Progress System Firmware Progress feature.

6. Fixed inability to reset the system under DOS by pressing "Ctrl-Alt-Del" on USB keyboard when "Port 60/64 Emulation" is disabled.

7. Fixed problem of SMC skipping first boot option in UEFI mode when retrying boot.

8. Fixed malfunction of "SMBIOS Preservation" Disabled.

9. Fixed issue of all commands requesting to be persistent.

10. Disabled CPU2 IIO PCIe root port ACPI hot plug function.

11. Fixed issue with IPMI force boot.

12. Fixed malfunction of option ROM control for AOC-MTG-i2TM and BPN-ADP-12NVMe-2UB.

13. Fixed problem of system hanging during BIOS flashing if Watch Dog function is enabled.

14. Fixed problem of the system not logging memory errors upon injection without rebooting.

15. Fixed incorrect LED behavior if VMD is disabled by stack but not by ports.