## **IPMI Firmware / BIOS Release Notes Form**

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

<b>Product Name</b>	H11DSU-iN (1.02A)
Release Version	1.1b
Release Date	8/20/2018
<b>Previous Version</b>	1.1a
<b>Update Category</b>	Critical
Dependencies	N/A
Important Notes	ECO #21231 BIOS Image H11DSU8.820 Please update BIOS with attached Flash Utility in package.
Enhancements	<ol> <li>Updated AGESA NaplesPI to 1.0.0.9 based on AMI CRB_019.</li> <li>Set different NVMe redriver values for different backplanes.</li> <li>Updated PSP fixed region when using AFU tool.</li> <li>Added support for NVMe hotplug function with AOC-UR-i2XT UIO riser card.</li> <li>Set 24-bay backplane offset 0x03 to 0x0C for detecting the last 12 NVMe ports.</li> <li>Updated Intel i350 PXE ROM to 1.5.84 and UEFI driver to 5.3.00.</li> <li>Updated X540 PXE ROM to v2.3.64.</li> </ol>
New features	N/A
Fixes	<ol> <li>Fixed problem of Memory configuration page being hidden.</li> <li>Fixed inability of Mellanox CX-4 to work in Linux when 2TB memory is installed.</li> </ol>

## 1.1a (4/26/2018)

- 1. Updated AGESA NaplesPI to 1.0.0.7 based on AMI CRB\_017.
- 2. Added support for graphic in Early Video mode.
- 3. Added support for a hidden item "Memory Corrected Error Enabling" to disable OS logs CECC error.
- 4. Added support for NVMe hotplug
- 5. Fixed inability to execute the iSCSI OPROM of Intel x550 LAN card.

3. The undonly to execute the ises of Now of Interx550 LAN curu.
<ol><li>Updated AMI PSPDATA region and FV_BB in recovery mode.</li></ol>
7. Fixed problem of UEFI LAN driver executing when CSM is disabled and onboard LAN Option
ROM Type is Legacy.
8. Fixed the location of SMCI signature in CMOS.
9. Fixed problem of SMBIOS types 1 and 2 not being kept after flashing BIOS.
10. Fixed inability to keep DMI data and some BIOS settings after SUM updates BIOS.
1.1 (2/7/2018)
1. Updated AGESA NaplesPI to 1.0.0.5 based on AMI CRB_014.