

IPMI Firmware / BIOS Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X9DRT-P/PT/PIBF/PIBQ
Release Version	3.3
Release Date	11/28/2018
Previous Version	3.2
Update Category	Recommended
Dependencies	None
Important Notes	None
Enhancements	<ol style="list-style-type: none">1. Updated CPU microcode to address 'Spectre' derivatives (CVE-2018-3639, CVE-2018-3640, and CVE-2017-5715) security issue.2. Changed to checking KCS status register instead of data register for KCS waiting.3. Fixed problem of 0 showing as length of DMI Type 15 log area.4. Set CECC error reporting to disabled by default.5. Patched problem of SPS ME NM function "Dynamic CPU Core Allocation Control" working abnormally.6. Added support for InnoDisk DIMM.7. Updated SATA RAID/SCU OPROM/EFI driver to RSTe PreOS v4.6.0.1018 (RSTe SATA 4.6.0.1091 and NVMe 4.6.0.2127).8. Added checksum check and retry for PSU FRU information request from BMC to patch missing PSU information in SMBIOS and added support for non-Supermicro PSU.

	<p>9. Added BAR offset judgment code to fix issue of Mellanox IB hanging at POST code 0x91.</p> <p>10. Updated SINIT ACM 2.4 (20150106).</p> <p>11. Updated module for security issues.</p>
New features	N/A
Fixes	<p>1. Fixed issue of SUM TC306 and TC317 failing in certain configuration cases.</p> <p>2. Fixed problem of DMI being cleared after updating BIOS by AFUDOS and then updating again by OOB.</p> <p>3. Fixed failure of SUM TC320.</p> <p>4. Fixed inability of PERR event log to be recorded correctly.</p> <p>5. Fixed inability of the device behind PCI to PCI bridge to be allocated resource.</p> <p>6. Fixed issue of the UEFI devices still being bootable after disabling UEFI from boot group.</p> <p>7. Fixed problem of DMI being lost after flashing BIOS by tool and then OOB updates BIOS.</p> <p>8. Fixed inability of Slim DVD ROM to read data from dual layer DVD image.</p> <p>9. Fixed problem of LSI 9267-8i (LSI 2108) stalling after pressing Ctrl+H to enter WebBIOS.</p> <p>10. Fixed problem of SOL not working under DOS.</p> <p>11. Fixed problem of the SMBIOS Type 17 showing TotalWidth & DataWidth information when the memory slot is empty.</p> <p>12. Fixed inability of USB Key (USB HDD type) to boot to DOS when 4K Native HDD is attached.</p> <p>13. Fixed problem of TPM State setup menu not syncing with actual setting.</p> <p>14. Fixed failure of IPMI system boot command.</p>

	15. Fixed problem of PRAD AE_NOT_FOUND occurring in dmesg.
--	---