

IPMI Firmware / BIOS Release Notes Form

Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.

Product Name	X9DRW-7TPF/iTPF
Release Version	3.3
Release Date	11/9/2018
Previous Version	3.2
Update Category	Recommended
Dependencies	None
Important Notes	None
Enhancements	1. Updated CPU microcode to address 'Spectre' derivatives (CVE-2018-3639 and CVE-2018-3640) security issue. 2. Set CECC error reporting to disabled by default. 3. Displayed CPU PCIe bifurcation items. 4. Changed to checking KCS status register instead of data register for KCS waiting. 5. Added support for InnoDisk DIMM. 6. Updated SATA RAID/SCU OPROM/EFI driver to RSTe PreOS v4.6.0.1018. 7. Added checksum check and retry for PSU FRU information request from BMC to patch missing PSU information in SMBIOS and added support for non-Supermicro PSU. 8. Updated SINIT ACM 2.4 (20150106). 9. Updated module for security issues.

New features	N/A
Fixes	<p>1. Fixed inability of Slim DVD ROM to read data from dual layer DVD image.</p> <p>2. Patched problem of SPS ME NM function "Dynamic CPU Core Allocation Control" working abnormally.</p> <p>3. Fixed problem of DMI being lost after flashing BIOS by tool and then OOB updates BIOS.</p> <p>4. Fixed inability to insert OA3 and clear OA2 backup area.</p> <p>5. Fixed problem of 0 showing as length of DMI Type 15 log area.</p> <p>6. Fixed issue of the UEFI devices still being bootable after disabling UEFI from boot group.</p> <p>7. Fixed inability of PERR event log to be recorded correctly.</p> <p>8. Fixed failure of SUM TC320.</p> <p>9. Fixed problem of the shift key being lost when pressing shift key without releasing.</p> <p>10. Fixed problem of SUM receiving wrong default setting of COM2 Console Redirection option.</p> <p>11. Fixed problem of DMI being lost after flashing BIOS by AFUDOS 2.39 then OOB updates BIOS.</p> <p>12. Fixed inability of the device behind PCI to PCI bridge to be allocated resource.</p> <p>13. Fixed problem of SOL not working under DOS.</p> <p>14. Fixed problem of the SMBIOS Type 17 showing TotalWidth & DataWidth information when the memory slot is empty.</p> <p>15. Fixed problem of TPM State setup menu not syncing with actual setting.</p> <p>16. Fixed failure of IPMI system boot command.</p> <p>17. Fixed problem of string overlap occurring in "Manage MegaRAID Advanced Software Options" page of AVAGO MegaRAID SAS 9460-8i</p>

	<p>UEFI driver.</p> <p>18. Added BAR offset judgment code to fix issue of Mellanox IB hanging at POST code 0x91.</p> <p>19. Fixed problem of SUM receiving wrong default setting of COM2 Console Redirection option when loading BIOS default by SUM.</p>
--	---