

## IPMI Firmware / BIOS Release Notes Form

*Supermicro disclaims all express and implied warranties, including without limitation, the implied warranties of merchantability, fitness for a particular purpose, and non-infringement, as well as any warranty arising from course of performance, course of dealing, or usage in trade. All products, computer systems, dates, and figures specified are preliminary based on current expectations, and are subject to change without notice. Supermicro and the Supermicro logo are trademarks of Super Micro Computer, Inc. in the U.S. and/or other countries. Copyright © 2018 Super Micro Computer, Inc. All rights reserved.*

<b>Product Name</b>	<b>X9DRFF-7(T)G+/i(T)G+</b>
<b>Release Version</b>	<b>3.3</b>
<b>Release Date</b>	<b>5/23/2018</b>
<b>Previous Version</b>	<b>3.2</b>
<b>Update Category</b>	<b>Recommended</b>
<b>Dependencies</b>	<b>None</b>
<b>Important Notes</b>	<b>None</b>
<b>Enhancements</b>	<b>1. Updated CPU microcode to address 'Spectre' derivatives (CVE-2018-3639, CVE-2018-3640, and CVE-2017-5715) security issue. 2. Changed to checking KCS status register instead of data register for KCS waiting. 3. Added checksum check and retry for PSU FRU information request from BMC to patch missing PSU information in SMBIOS and added support for non-Supermicro PSU. 4. Updated module for security issues. 5. Added security update.</b>
<b>New features</b>	<b>N/A</b>
<b>Fixes</b>	<b>1. Fixed issue of SUM TC306 and TC317 failing in certain configuration cases.</b>

	<p>2. Fixed problem of DMI being cleared after updating BIOS by AFUDOS and then updating again by OOB.</p> <p>3. Fixed failure of SUM TC320.</p> <p>4. Fixed inability of PERR event log to be recorded correctly.</p> <p>5. Fixed issue of the UEFI devices still being bootable after disabling UEFI from boot group.</p> <p>6. Fixed problem of 0 showing as length of DMI Type 15 log area.</p> <p>7. Fixed inability to insert OA3 and clear OA2 backup area.</p> <p>8. Fixed problem of DMI being lost after flashing BIOS by tool and then OOB updates BIOS.</p> <p>9. Patched problem of SPS ME NM function "Dynamic CPU Core Allocation Control" working abnormally.</p> <p>10. Fixed inability of Slim DVD ROM to read data from dual layer DVD image.</p> <p>11. Fixed problem of SOL not working under DOS.</p> <p>12. Fixed problem of the SMBIOS Type 17 showing TotalWidth &amp; DataWidth information when the memory slot is empty.</p> <p>13. Fixed inability of USB Key (USB HDD type) to boot to DOS when 4K Native HDD is attached.</p> <p>14. Fixed problem of TPM State setup menu not syncing with actual setting.</p> <p>15. Fixed failure of IPMI system boot command.</p> <p>16. Added BAR offset judgment code to fix issue of Mellanox IB hanging at POST code 0x91.</p>
--	---